

MPL3115A2 I²C precision pressure sensor with altimetry Rev. 5.2 — 5 April 2017 Data

Data sheet: Technical data

General description 1

The MPL3115A2 is a compact, piezoresistive, absolute pressure sensor with an I²C digital interface. MPL3115A2 has a wide operating range of 20 kPa to 110 kPa, a range that covers all surface elevations on earth. The MEMS is temperature compensated utilizing an on-chip temperature sensor. The pressure and temperature data is fed into a high resolution ADC to provide fully compensated and digitized outputs for pressure in Pascals and temperature in °C. The compensated pressure output can then be converted to altitude, utilizing the formula stated in Section 8.1.3 "Pressure/altitude" provided in meters. The internal processing in MPL3115A2 removes compensation and unit conversion load from the system MCU, simplifying system design.

MPL3115A2's advanced ASIC has multiple user programmable modes such as power saving, interrupt and autonomous data acquisition modes, including programmed acquisition cycle timing, and poll-only modes. Typical active supply current is 40 µA per measurement-second for a stable 10 cm output resolution.

Features and benefits 2

- Operating range: 20 kPa to 110 kPa absolute pressure
- –700 m to be equivalent altitude at 50 kPa
- Calibrated range: 50 kPa to 110 kPa absolute pressure
- Calibrated temperature output: −40 °C to 85 °C
- I²C digital output interface (up to 400 kHz)
- Fully compensated internally
- Precision ADC resulting in 0.1 meter of effective resolution
 1.6 V to 3.6 V digital interface supply voltage
- Direct reading
 - Pressure: 20-bit measurement (Pascals)
 - 20 to 110 kPa
 - Altitude: 20-bit measurement (meters) – 698 to 11,775 m
 - Temperature: 12-bit measurement (°C)
 - –40 °C to 85 °C

- Programmable interrupts
- Autonomous data acquisition
 - Embedded 32-sample FIFO
 - Data logging up to 12 days using the FIFO
- One-second to nine-hour data acquisition rate
- 1.95 V to 3.6 V supply voltage, internally regulated
- Operating temperature from −40 °C to +85 °C



I²C precision pressure sensor with altimetry


3 Applications

- · High-accuracy altimetry and barometry
- · Smartphones, tablets and wearable devices
- GPS applications: dead reckoning, map assist, navigation, enhancement for emergency services
- Weather station equipment

4 Ordering information

Table 1. Ordering	information								
Device number Shipping		ng Package Nu		Number of ports			Pressure Ty	Digital	
			None	Single	Dual	Gauge	Differential	Absolute	interface
MPL3115A2	Tray	98ASA002260D	•	—	_	—	_	•	•
MPL3115A2R1	Tape and reel	98ASA002260D	•	—		—		•	•


5 Block diagram

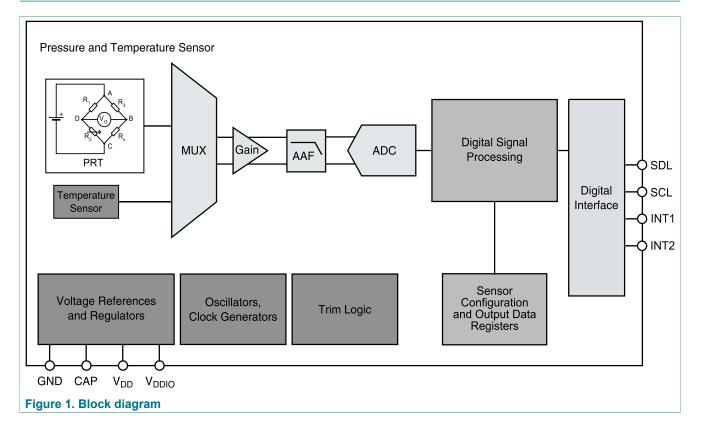

I²C precision pressure sensor with altimetry

6 **Pinning information**

6.1 Pinning

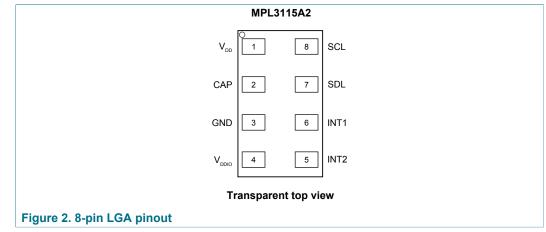


6.2 Pin description

Table 2. Pin description

Pin	Description					
1	V_{DD} power supply connection (1.95 to 3.6 V)					
2	External capacitor					
3	Ground					
4	Digital interface power supply (1.62 to 3.6 V)					
5	Pressure interrupt 2					
6	Pressure interrupt 1					
7	I ² C serial data					
8	I ² C serial clock					
	Pin 1 2 3 4 5 6 7					

7 System connections

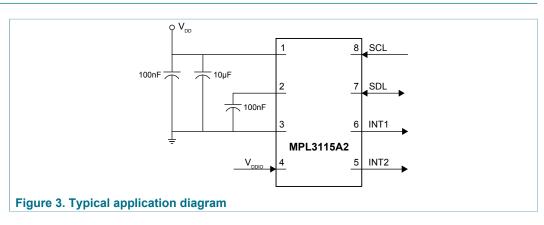

© NXP B.V. 2017. All rights reserved.

I²C precision pressure sensor with altimetry

The device power is supplied through the V_{DD} line. Power supply decoupling capacitors (100 nF ceramic plus 10 μ F bulk or 10 μ F ceramic) should be placed as near as possible to pin 1 of the device. A second 100 nF capacitor is used to bypass the internal regulator. The functions, threshold and the timing of the interrupt pins (INT1 and INT2) are user programmable through the I²C interface.

8 Mechanical and electrical specifications

8.1 Terminology

8.1.1 Resolution

The resolution of a pressure sensor is the minimum change of pressure that can be reliably measured. The usable resolution of the device is programmable, enabling the user to choose a compromise between acquisition speed, power consumption, and resolution that best fits the application. To simplify the programming, the data is always reported in the same format with differing number of usable bits.

8.1.2 Accuracy

8.1.2.1 Offset

The offset is defined as the output signal obtained when the reference pressure (a vacuum for an absolute pressure sensor) is applied to the sensor. Offset error affects absolute pressure measurements but not relative pressure measurements. An altitude measurement is the pressure value in comparison to sea level, a barometric measurement is the pressure value read by the sensor. That is, a measurement of total pressure seen (for example 70 kPa), or total height (for example 3000 m) above sea level. A change in the offset will affect the pressure value or height seen above sea level as it shifts the sea level base reference. An absolute pressure measurement is not the same as relative pressure measurement, where the pressure is compared when raising or lowering pressure in shorter intervals. This would be a walk up a hill, measuring the pressure and altitude difference from start to finish. In the relative case, the offset shifts are shared in the two absolute measurements and negate each other during the pressure calculation.

For the MPL3115A2, the long term offset shift can be removed by adjusting the pressure or altitude offset correction. See <u>Section 13.23 "Offset correction registers"</u>. This adjustment is provided to override the factory programmed values to compensate for offsets introduced by manufacturing and mounting stresses. It is highly recommended that this is utilized to realize the full accuracy potential of the device.

8.1.2.2 Linearity

Linearity compares the slope of the measurement data to that of an ideal transfer function. It refers to how well a transducer's output follows the equation $P_{OUT} = P_{OFF}$ + sensitivity × P straight-line equation over the operating pressure range. The method used by NXP to give the linearity specification is the end-point straight line method measured at midrange pressure.

I²C precision pressure sensor with altimetry

8.1.2.3 Absolute pressure

Absolute pressure sensors measure an external pressure relative to a zeropressure reference (vacuum) sealed inside the reference chamber of the die during manufacturing. This standard allows comparison to a standard value set such that 14.7 psi = 101,325 Pa = 1 atm at sea level as a measurement target. The absolute pressure is used to determine altitude as it has a constant reference for comparison. Measurement at sea level can be compared to measurement at a mountain summit as they use the same vacuum reference. The conversion of absolute pressure to altitude in meters is calculated based on US Standard Atmosphere 1976 (NASA).

Note: Absolute pressure is not linear in relation to altitude, it is an exponential function. The value of altitude can be read directly from the device in increments of 0.0625 meters, or the value of pressure in 0.25 Pascal (Pa) units.

8.1.2.4 Span

Span is the value of full-scale output with offset subtracted, representing the full range of the pressure sensor. Ideally the span is a specification over a constant temperature. The device uses internal temperature compensation to remove drift. Span accuracy is the comparison of the measured difference and the actual difference between the highest and lowest pressures in the specified range.

8.1.3 Pressure/altitude

The device is a high accuracy pressure sensor with integrated data calculation and logging capabilities. To provide altitude readings, the altitude calculations are based on the measured pressure (p), the user input of the equivalent sea level pressure to compensate for local weather conditions (OFF_H) and the US Standard Atmosphere 1976 (NASA). Pressure is given in Pascals (Pa), and fractions of a Pa. Altitude is given in meters (m) and fractions of a meter. The altitude is calculated from the pressure using the following equation:

$$h = 44330.77 \left\{ 1 - \left(\frac{p}{p_0}\right)^{0.1902632} \right\} + OFF_H (Register value)$$

where:

 p_0 = sea level pressure (101,326 Pa) h = altitude in meters

8.2 Absolute maximum ratings

Absolute maximum ratings are the limits the device can be exposed to without permanently damaging it. Absolute maximum ratings are stress ratings only, functional operation at these ratings is not guaranteed. Exposure to absolute maximum ratings conditions for extended periods may affect device reliability.

This device contains circuitry to protect against damage due to high static voltage or electrical fields. It is advised, however, that normal precautions be taken to avoid application of any voltages higher than maximum-rated voltages to this high-impedance circuit.

MPL3115A2

I²C precision pressure sensor with altimetry

Table 3. Maximu	m ratings		
Symbol	Characteristic	Value	Unit
P _{max}	Maximum applied pressure	500	kPa
V _{DD}	Supply voltage	-0.3 to 3.6	V
V _{DDIO}	Interface supply voltage	-0.3 to 3.6	V
V _{IN}	Input voltage on any control pin (SCL, SDA)	-0.3 to V _{DDIO} + 0.3	V
T _{OP}	Operating temperature range	-40 to +85	°C
T _{STG}	Storage temperature range	−40 to +125	°C

Table 4. ESD and latchup protection characteristics

Symbol	Rating	Value	Unit
HBM	Human body model	±2000	V
CDM	Charge device model	±500	V
	Latchup current at T = 85 °C	±100	mA



This device is sensitive to mechanical shock. Improper handling can cause permanent damage to the part or cause the part to otherwise fail.

Caution



Caution This is an ESD sensitive device. Improper handling can cause permanent damage to the part.

8.3 Mechanical characteristics

Table 5. Mechanical characteristics

 V_{DD} = 2.5 V, T = 25 °C, over 50 kPa to 110 kPa, unless otherwise noted.

Symbol	Parameter	Test conditions	Min	Тур	Мах	Unit
Pressure ser	isor					
P _{FS}	Measurement range	Calibrated range	50		110	kPa
		Operational range	20		110	kPa
	Pressure reading noise [1]	1x oversample		19		Pa RMS
		128x oversample		1.5		Pa RMS
	Pressure absolute accuracy	50 to 110 kPa over 0 °C to 50 °C	-0.4		0.4	kPa
		50 to 110 kPa over−10 °C to 70 °C		±0.4		kPa

© NXP B.V. 2017. All rights reserved.

MPL3115A2

I²C precision pressure sensor with altimetry

Symbol	Parameter	Test conditions	Min	Тур	Max	Unit
	Pressure relative accuracy	Relative accuracy during pressure change between 70 to 110 kPa at any constant temperature between -10 °C to 50 °C		±0.05		kPa
		Relative accuracy during changing temperature between -10 °C to 50 °C at any constant pressure between 50 kPa to 110 kPa		±0.1		kPa
	[2][3][4]	Barometer mode	0.25	1.5		Pa
		Altimeter mode	0.0625	0.3		m
	Output data rate	One-shot mode		100		Hz
		FIFO mode			1	Hz
	Board mount drift	After solder reflow		±0.15		kPa
	Long term drift	After a period of 1 year		±0.1		kPa
Temperature	e sensor					
T _{FS}	Measurement range		-40		+85	°C
	Temperature accuracy	@25 °C		±1		°C
		Over temperature range		±3		°C
T _{OP}	Operating temperature range	-	-40		+85	°C

[1] Oversample (OSR) modes internally combine and average samples to reduce noise.

Smallest bit change in register represents minimum value change in Pascals or meters. Typical resolution to signify change in altitude is 0.3 m. Reference pressure = 101.325 kPa (sea level).

[2] [3] [4]

At 128x oversample ratio.

8.4 Electrical characteristics

Table 6. Electrical characteristics

@ V_{DD} = 2.5 V, T = 25 °C unless otherwise noted.

Symbol	Parameter	Test conditions	Min	Тур	Мах	Unit
V _{DDIO}	I/O supply voltage	—	1.62	1.8	3.6	V
V _{DD}	Operating supply voltage	—	1.95	2.5	3.6	V
I _{DD}	Integrated current 1 update per second	Highest speed mode oversample = 1	_	8.5	_	μA
		Standard mode oversample = 16		40	_	μA
		High resolution mode oversample = 128	_	265		μA
I _{DDMAX}	Max current during acquisition and conversion	During acquisition/ conversion	—	2	—	mA
IDDSTBY	Supply current drain in STANDBY mode	STANDBY mode selected SBYB = 0	_	2	_	μA

© NXP B.V. 2017. All rights reserved.

MPL3115A2

I²C precision pressure sensor with altimetry

Symbol	Parameter	Test conditions	Min	Тур	Мах	Unit
VIH	Digital high level input voltage SCL, SDA	_	0.75	_		V _{DDIO}
VIL	Digital low level input voltage SCL, SDA	_	_	_	0.3	V _{DDIO}
VOH	High level output voltage INT1, INT2	I _O = 500 μA	0.9		—	V _{DDIO}
VOL	Low level output voltage INT1, INT2	Ι _Ο = 500 μΑ	_	_	0.1	V _{DDIO}
VOLS	Low level output voltage SDA	Ι _Ο = 500 μΑ	—	_	0.1	V _{DDIO}
T _{ON}	Turn-on time ^{[1][2][3]}	High speed mode	_		60	ms
		High resolution mode	_		1000	ms
T _{OP}	Operating temperature range	-	-40	25	+85	°C
I ² C addressin	Ig	1		1		,
I ² C Address	_	_		0x60		Hex

[1] [2] [3] Time to obtain valid data from STANDBY mode to ACTIVE mode

High speed mode is achieved by setting the oversample rate of 1x. High resolution mode is achieved by setting the oversample to 128x.

I²C precision pressure sensor with altimetry

Digital interface 9

The registers embedded inside the device are accessed through an I^2C serial interface.

Table 7. Serial interface pin descriptions

Name	Description
SCL	I ² C serial clock
SDA	I ² C serial data

9.1 I²C characteristics

Table 8. I²C Slave timing values

All values referred to VIH(min) and VIL(max) levels.

Symbol	Parameter	l ² C	Unit		
		Condition	Min	Max	-
f _{SCL}	SCL clock frequency	Pull-up = 1 kΩ, Cb = 400 pF	0	400	kHz
f _{SCL}	SCL clock frequency	Pull-up = 1 kΩ, Cb = 20 pF	0	4	MHz
t _{BUF}	Bus free time between STOP and START condition		1.3	_	μs
t _{HD;STA}	Repeated START hold time	—	0.6		μs
t _{SU;STA}	Repeated START setup time	—	0.6		μs
t _{su;sто}	STOP condition setup time	—	0.6		μs
t _{HD;DAT}	SDA data hold time ^{[1][2][3]}	—	50		ns
t _{SU;DAT}	SDA setup time ^[4]	_	100		ns
t _{LOW}	SCL clock low time	_	1.3		μs
t _{HIGH}	SCL clock high time	_	0.6		μs
t _r	SDA and SCL rise time ^[5]	_	20 + 0.1C _b	300	ns
t _f	SDA and SCL fall Time [2][5][6][7]	_	20+ 0.1C _b	300	ns
t _{SP}	Pulse width of spikes that are suppressed by internal input filter		-	50	ns

[1]

t_{HD;DAT} is the data hold time that is measured from the falling edge of SCL, applies to data in transmission and the acknowledge. The device must internally provide a hold time of at least 300 ns for the SDA signal (with respect to the VIH(min) of the SCL signal) to bridge the undefined region of the falling edge of SCL [2]

The maximum t_{HD;DAT} must be less than the maximum of t_{VD;DAT} or t_{VD;ACK} by a transition time. This device does not stretch the LOW period (t_{LOW}) of the [3] SCL signal.

A fast mode I²C device can be used in a standard mode I²C system, but the requirement t_{SU;DAT} 250 ns must then be met. This will automatically be the [4] case if the device does not stretch the LOW period of the SCL signal. If such a device does stretch the LOW period of the SCL signal, if such a device does stretch the LOW period of the SCL signal, it must output the next data bit to the SDA line $t_{c}(max) + t_{SU;DAT} = 1000 + 250 = 1250$ ns (according to the standard mode I²C specification) before the SCL line is released. Also the acknowledge timing must meet this set-up time. Cb = Total capacitance of one bus line in pF.

[5]

The maximum t_f for the SDA and SCL bus lines is specified at 300 ns. The maximum fall time for the SDA output stage t_f is specified at 250 ns. This [6] allows series protection resistors to be connected in between the SDA and the SCL pins and the SDA/SCL bus lines without exceeding the maximum specified tr.

In fast mode plus, fall time is specified the same for both output stage and bus timing. If series resistors are used, designers should allow for this when [7] considering bus timing.

I²C precision pressure sensor with altimetry


9.2 I²C operation

The transaction on the bus is started through a start condition (START) signal. START condition is defined as a HIGH to LOW transition on the data line while the SCL line is held HIGH. After START has been transmitted by the master, the bus is considered busy. The next byte of data transmitted after START contains the slave address in the first 7 bits, and the eighth bit tells whether the master is receiving data from the slave or transmitting data to the slave. When an address is sent, each device in the system compares the first seven bits after a start condition with its address. If they match, the device considers itself addressed by the master. The ninth clock pulse, following the slave address byte (and each subsequent byte) is the acknowledge (ACK).The transmitter must release the SDA line during the ACK period. The receiver must then pull the data line low so that it remains stable low during the high period of the acknowledge clock period.

The number of bytes per transfer is unlimited. If the master cannot receive another complete byte of data until it has performed some other function, it can hold the clock line, SCL low to force the transmitter into a wait state. Data transfer only continues when the master is ready for another byte and releases the clock line.

A low to high transition on the SDA line while the SCL line is high is defined as a stop condition (STOP). A data transfer is always terminated by a STOP. A master may also issue a repeated START during a data transfer. Device expects repeated STARTs to be used to randomly read from specific registers.

The standard 7-bit I^2C slave address is 60h or 1100000. 8-bit read is C1h, 8-bit write is C0h.

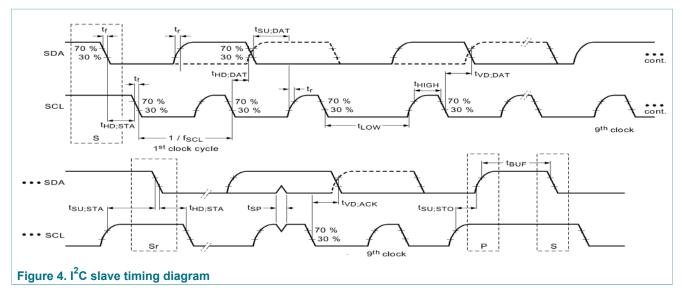

I²C precision pressure sensor with altimetry

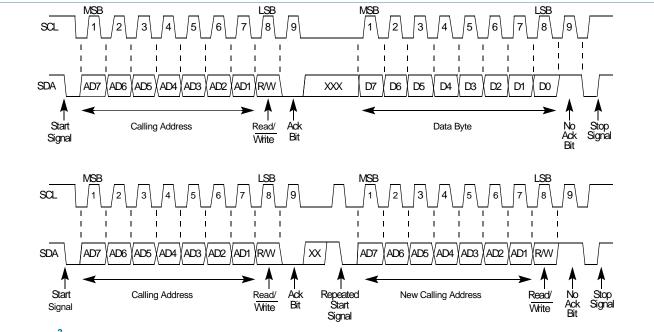


Figure 5. I²C bus transmission signals

Consult factory for alternate addresses. See the application note titled Sensor I²C Setup and FAQ (document AN4481).

10 Modes of operation

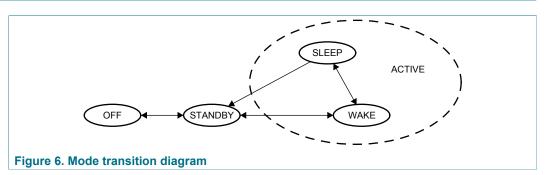


Table 9. Mode of operation description

Mode	I ² C-bus state	V _{DD}	Condition	Function description
OFF	Powered down	< 1.62 V	< V _{DD} + 0.3 V	Device is powered off.
STANDBY	I ² C/SPI communication with the device is possible	ON	SBYB bit of CTRL_REG1 is cleared	Only POR and digital blocks are enabled. Analog subsystem is disabled.
ACTIVE	I ² C/SPI communication with the device is possible	ON	SBYB bit of CTRL_REG1 is set	All blocks are enabled (POR, digital, analog).

MPL3115A2 Data sheet: Technical data

10.1 OFF

Unit is powered down and has no operating functionality. V_{DD} and V_{DDIO} are not powered.

10.2 STANDBY

The digital sections are operational and the unit is capable of receiving commands and delivering stored data. The analog sections are off. The part is waiting for CTRL_REG1 to be configured and the part to enter active mode.

10.3 ACTIVE


Both analog and digital sections are running. The unit is capable of gathering new data, and accepting commands. The device is fully functional.

11 Quick start setup


To set up the device in altimeter mode, you may select your data retrieval method between polling (no FIFO), interrupt (no FIFO) or with the FIFO. The flow charts in Figure $\underline{7}$ and Figure 8 describe the setup for polling or interrupt with an OSR of 128.

For more information, see application note titled Data Manipulation and Basic Settings of the MPL3115A2 Command Line Interface (document AN4519).

I²C precision pressure sensor with altimetry

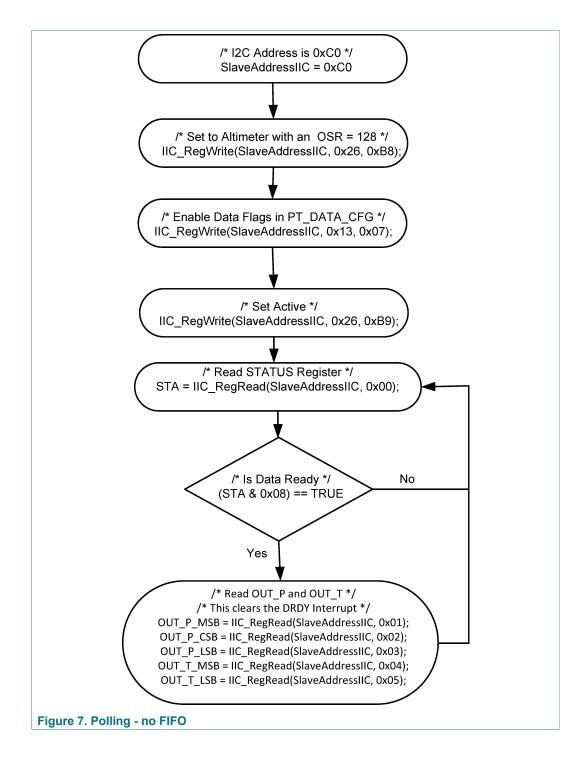

I²C precision pressure sensor with altimetry

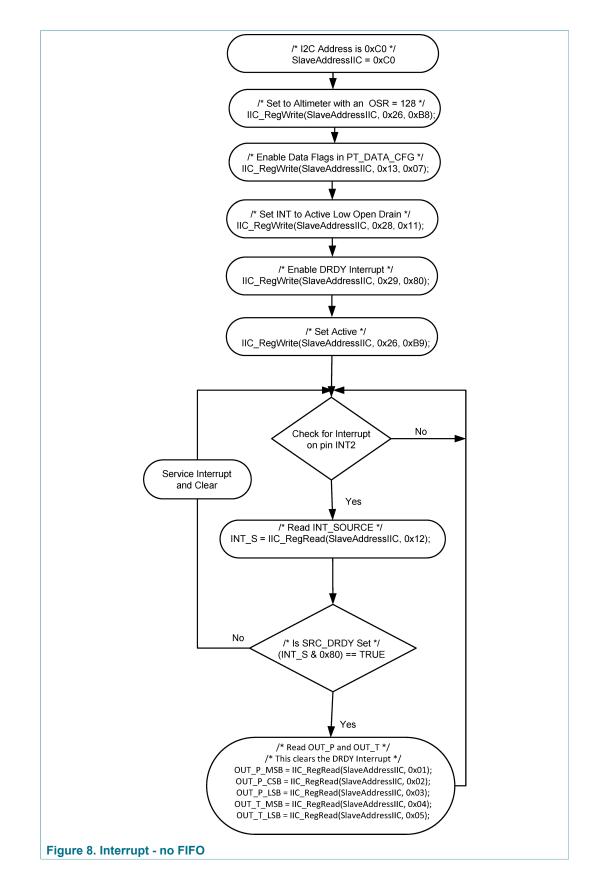

© NXP B.V. 2017. All rights reserved.

I²C precision pressure sensor with altimetry

12 Functionality

The device is a low-power, high accuracy, digital output altimeter, barometer and thermometer, packaged in a $3 \times 5 \times 1.1$ mm form factor. The complete device includes a sensing element, analog and digital signal processing and an I^2C interface.

The device has two operational modes, barometer and altimeter. Both modes include a thermometer temperature output function.

Power consumption and sensitivity are programmable where the data oversampling ratio can be set to balance current consumption and noise/resolution. Serial interface communication is through an I²C interface thus making the device particularly suitable for direct interfacing with a microcontroller. The device features two independently programmable interrupt signals INT1 and INT2. These can be set to generate an interrupt signal when a new set of pressure/altitude and temperature data is available, thereby simplifying data acquisition for the host controller. These interrupt pins can also be configured to generate interrupts when a user programmed set of conditions are met (see Section 12.6 "External interrupts").

Examples are:

- · interrupt can be triggered when a single new data acquisition is ready
- · when a desired number of samples are stored within the internal FIFO
- when a change of pressure/altitude or temperature is detected.

In RAW mode, the FIFO must be disabled and all other functionality including alarms, deltas and other interrupts are disabled.

12.1 Factory calibration

The device is factory calibrated for sensitivity, offset for both temperature and pressure measurements. Trim values are stored on-chip, in non-volatile memory (NVM). In normal use, further calibration is not necessary. However, in order to realize the highest possible accuracy, the device allows the user to override the factory set offset values after power-up. The user adjustments are stored in volatile registers. The factory calibration values are not affected, and are always used by default on power-up.

12.2 Barometer/altimeter function

The mode of operation of the device can be selected as barometer or altimeter. The internal sensor gives an absolute pressure signal. The absolute pressure signal is processed to provide a scaled pressure or an altitude, depending on the mode selected. The combination of a high performance sensor and the signal processing enable resolution of pressures below 1 Pa and altitude resolution of better than 1 m at sea level.

When in barometer mode, all pressure related data is reported as 20-bit unsigned data in Pascals. When in altimeter mode, all pressure data is converted to equivalent altitude, based on the US standard atmosphere and then stored as 20-bit 2's complement value in meters and fractions of a meter.

12.2.1 Barometric input

In order to accurately determine the altitude by pressure, the OFF_H register (see <u>Section 13.23.3 "OFF_H - altitude data user offset register (address 2Dh)"</u>) is provided to

I²C precision pressure sensor with altimetry

input the local barometric pressure correction. The default value is 101,326 Pa since the BAR_IN_MSB and BAR_IN_LSB registers are in units of 2 Pascals per LSB.

12.3 Temperature function

The unit contains a high-resolution temperature sensor that provides data to the user via a 16-bit data register, as well as for internal compensation of the pressure sensor.

12.4 Autonomous data acquisition

The unit can be programmed to periodically capture altitude/pressure and temperature data. Up to 32 data acquisitions can be stored in the internal FIFO. The interval between acquisitions is programmable from one second to nine hours.

Data collection capabilities: (up to 32 samples over 12 days). The unit can also be programmed to make a single reading and then go to standby mode.

12.5 FIFO

A 32-sample FIFO is incorporated to minimize the overhead of collecting multiple data samples. The FIFO stores both temperature and pressure/altitude data. The device can be programmed to autonomously collect data at programmed intervals and store the data in the FIFO. FIFO interrupts can be triggered by watermark full or data contention (FIFO GATE) events.

12.6 External interrupts

Two independent interrupt out pins are provided. The configuration of the pins are programmable (polarity, open drain or push/pull.) Any one of the internal interrupt sources can be routed to either pin.

12.6.1 Reach target threshold pressure/altitude (SRC_PTH)

The interrupt flag is set on reaching the value stored in the pressure/altitude target register. Additionally, a window value provides the ability to signal when the target is nearing the value in the pressure/altitude target register from either above or below. When in barometer mode, these values represent pressures rather than altitudes.

Examples:

- Set altitude alert to 3000 m and window value to 100 m, interrupt is asserted passing 2900 m, 3000 m, and 3100 m.
- Set pressure alert to 100.0 kPa and window value to 5 kPa, interrupt can be sent passing 95 kPa, 100 kPa, and 105 kPa.

Note: When the window value is set to 0 then the interrupt will only be generated when reaching or crossing the target value.

12.6.2 Reach window target pressure/altitude (SRC_PW)

The interrupt flag is set when the pressure/altitude value is within the window defined by the following formula:

I²C precision pressure sensor with altimetry

 $Window = P_T GT_{MSB,LSB} + P_W IND_{MSB,LSB}$

Note: No interrupt is generated if the P_WND value is set to 0.

12.6.3 Reach target threshold temperature (SRC_TTH)

Interrupt flag is set on reaching the value stored in the temperature target register. Additionally a window value provides ability to signal when the target is nearing from either above or below the value in the temperature target register.

Note: When the window value is set to 0 then the interrupt will only be generated when reaching or crossing the target value.

12.6.4 Reach window target temperature (SRC_TW)

The interrupt flag is set when the temperature value is within the window defined by the following formula:

 $Window = T_TGT \pm T_WIND$

Note: No interrupt is generated if the T_WND value is set to 0.

12.6.5 Pressure/altitude change (SRC_PCHG)

Interrupt flag is set if sequential pressure/altitude acquisitions exceed value stored in pressure/altitude window value register.

12.6.6 Temperature change (SRC_TCHG)

Interrupt flag is set if sequential temperature acquisitions exceed the value stored in pressure/altitude window value register.

12.6.7 Data ready

Interrupt flag is set when new data or a data overwrite event has occurred. PTOW and/or PTDR (DR_STATUS register) must be set for an interrupt to be generated.

12.6.8 FIFO event

Interrupt flag is set when either an overflow or watermark event has occurred. For more information see <u>Section 13.8 "FIFO setup registers"</u>.

12.6.9 Pressure/altitude and temperature delta

Registers show the differences from the last pressure/altitude and temperature samples.

12.6.10 Min/max data value storage

Registers record the minimum and maximum pressure/altitude and temperature.

I²C precision pressure sensor with altimetry

13 Register descriptions

Register Address	Name	Access	Reset value	Description	Reset when STBY to Active	Comment	Auto-inc addr	rement ess	Reference		
00h	STATUS	R	00h	Sensor status register ^[1] . ^[2]	Yes	Alias for DR_STATUS or F_STATUS	01	h	Section 13.1		
01h	OUT_P_MSB	time pressure sample. Root pointer to pressure		Root pointer to pressure and temperature FIFO	02h	01h	Section 13.3				
02h	OUT_P_CSB	R	00h	Pressure data out CSB ^{[1][2]}	Yes	data. Bits 4 to 11 of 20-bit real- time pressure sample	03	ĥ	Section 13.3		
03h	OUT_P_LSB	R	00h	Pressure data out LSB ^{[1][2]}	Yes	Bits 0 to 3 of 20-bit real- time pressure sample	04	h	Section 13.3		
04h	OUT_T_MSB	R	00h	Temperature data out MSB ^{[1][2]}	Yes	Bits 4 to 11 of 12-bit real- time temperature sample	05	ih	Section 13.4		
05h	OUT_T_LSB	R	00h	Temperature data out LSB ^{[1][2]}	Yes	Bits 0 to 3 of 12-bit real- time temperature sample	00	h	Section 13.4		
06h/00h	DR_STATUS	R	00h	Sensor status register ^{[1][2]}	Yes	Data ready status information	07	'n	Section 13.2		
07h	OUT_P_DELTA_MSB	R	00h	Pressure data out delta MSB ^{[1][2]}	Yes	Bits 12 to 19 of 20-bit pressure change data	80	h	Section 13.5		
08h	OUT_P_DELTA_CSB	R	00h	Pressure data out delta CSB ^{[1][2]}	Yes	Bits 4 to 11 of 20-bit pressure change data	09	h	Section 13.5		
09h	OUT_P_DELTA_LSB	R	00h	Pressure data out delta LSB ^{[1][2]}	Yes	Bits 0 to 3 of 20-bit pressure change data	0Ah		0Ah		Section 13.5
0Ah	OUT_T_DELTA_MSB	R	00h	Temperature data out delta MSB ^{[1][2]}	Yes	Bits 4 to 11 of 12-bit temperature change data	0Bh		0Bh		Section 13.6
0Bh	OUT_T_DELTA_LSB	R	00h	Temperature data out delta LSB ^{[1][2]}	Yes	Bits 0 to 3 of 12-bit temperature change data	06h		Section 13.6		
0Ch	WHO_AM_I	R	C4h	Device identification register	No	Fixed device ID number	0Dh		0Dh		Section 13.7
0Dh	F_STATUS	R	00h	FIFO status register ^{[1][2]}	Yes	FIFO status: no FIFO 0Eh event detected		h	Section 13.8.1		
0Eh/01h	F_DATA	R	00h	FIFO 8-bit data access ^{[1][2]}	Yes	FIFO 8-bit data access	0E	h	Section 13.8.2		
0Fh	F_SETUP	R/W	00h	FIFO setup register [1][3]	No	FIFO setup	10	h	Section 13.8.3		
10h	TIME_DLY	R	00h	Time delay register [1][2]	Yes	Time since FIFO overflow	11	h	Section 13.9		
11h	SYSMOD	R	00h	System mode register ^[2]	Yes	Current system mode	12	!h	Section 13.10		
12h	INT_SOURCE	R	00h	Interrupt source register [1]	No	Interrupt status	13	h	Section 13.11		
13h	PT_DATA_CFG	R/W	00h	PT data configuration register ^{[1][3]}	No	Data event flag configuration	14	h	Section 13.12		
14h	BAR_IN_MSB	R/W	C5h	BAR input in MSB ^{[1][3]}	No	Barometric input for altitude calculation bits 8 to15	15	ih	Section 13.13		
15h	BAR_IN_LSB	R/W	E7h	BAR input in LSB ^{[1][3]}	No	Barometric input for altitude calculation bits 0 to 7	altitude calculation bits 0		Section 13.13		
16h	P_TGT_MSB	R/W	00h	Pressure target MSB ^{[1][3]}	No	Pressure/altitude target value bits 8 to 15	17	'n	Section 13.14		
17h	P_TGT_LSB	R/W	00h	Pressure target LSB ^{[1][3]}	No	Pressure/altitude target value bits 0 to 7			Section 13.14		
18h	T_TGT	R/W	00h	Temperature target register [1][3]	No	Temperature target value	19h		Section 13.15		
19h	P_WND_MSB	R/W	00h	Pressure/altitude window MSB ^{[1][3]}	No	Pressure/altitude window value bits 8 to 15	1A	ιh	Section 13.16		
1Ah	P_WND_LSB	R/W	00h	Pressure/altitude window LSB ^{[1][3]}	No	Pressure/altitude window value bits 0 to 7	1E	h	Section 13.16		
1Bh	T_WND	R/W	00h	Temperature window register ^{[1][3]}	No	Temperature window value	1C	h	Section 13.17		
1Ch	P_MIN_MSB	R/W	00h	Minimum pressure data out MSB ^{[1][3]}	No	Minimum pressure/altitude bits 12 to 19	10	h	Section 13.18		
1Dh	P_MIN_CSB	R/W	00h	Minimum pressure data out CSB [1][3]	No	Minimum pressure/altitude bits 4 to 11	1E	h	Section 13.18		

MPL3115A2

MPL3115A2

I²C precision pressure sensor with altimetry

Register Address	Name	Access	Reset value	Description	Reset when STBY to Active	Comment	Auto-increment address	Reference
1Eh	P_MIN_LSB	R/W	00h	Minimum pressure data out LSB ^{[1][3]}	No	Minimum pressure/altitude bits 0 to 3	1Fh	Section 13.18
1Fh	T_MIN_MSB	R/W	00h	Minimum temperature data out MSB [1][3]	No	Minimum temperature bits 8 to15	20h	Section 13.20
20h	T_MIN_LSB	R/W	00h	Minimum temperature data out LSB [1][3]	No	Minimum temperature bits 0 to 7	21h	Section 13.20
21h	P_MAX_MSB	R/W	00h	Maximum pressure data out MSB ^{[1][3]}	No	Maximum pressure/ altitude bits 12 to 19	22h	Section 13.19
22h	P_MAX_CSB	R/W	00h	Maximum pressure data out CSB ^{[1][3]}	No	Maximum pressure/ altitude bits 4 to 11	23h	Section 13.19
23h	P_MAX_LSB	R/W	00h	Maximum pressure data out LSB ^{[1][3]}	No	Maximum pressure/ altitude bits 0 to 3	24h	Section 13.19
24h	T_MAX_MSB	R/W	00h	Maximum temperature data out MSB [1][3]	No	Maximum temperature bits 8 to 15	25h	Section 13.21
25h	T_MAX_LSB	R/W	00h	Maximum temperature data out LSB [1][3]	No	Maximum temperature bits 0 to 7	26h	Section 13.21
26h	CTRL_REG1	R/W	00h	Control register 1 [1][4]	No	Modes, oversampling	27h	Section 13.22.1
27h	CTRL_REG2	R/W	00h	Control register 2 ^[1]	No	Acquisition time step	28h	Section 13.22.2
28h	CTRL_REG3	R/W	00h	Control register 3 ^{[1][4]}	No	Interrupt pin configuration	29h	Section 13.22.3
29h	CTRL_REG4	R/W	00h	Control register 4 [1][4]	No	Interrupt enables	2Ah	Section 13.22.4
2Ah	CTRL_REG5	R/W	00h	Control register 5 [1][4]	No	Interrupt output pin assignment	2Bh	Section 13.22.5
2Bh	OFF_P	R/W	00h	Pressure data user offset register	No	Pressure data offset	2Ch	Section 13.23
2Ch	OFF_T	R/W	00h	Temperature data user offset register	No	Temperature data offset	2Dh	Section 13.23.2
2Dh	OFF_H	R/W	00h	Altitude data user offset register	No	Altitude data offset	0Ch	Section 13.23.3

[1]

Register contents are preserved when transitioning from ACTIVE to STANDBY mode Register contents are reset when transitioning from STANDBY to ACTIVE mode. Register contents can be modified anytime in STANDBY or ACTIVE mode. Modification of this register's contents can only occur when device in STANDBY mode except the SBYB, OST and RST bit fields in CTRL_REG1 register. [2] [3] [4]

Table 11. Register address map: Area A (F_Mode = 0, FIFO disabled)

Register Address	Name	Access	Reset value	Description	Reset when STBY to Active	Comment	Auto-increment address		Reference
00h/06h	DR_STATUS ^[1]	R	00h	Sensor status register	Yes	DR_STATUS	01	lh	Section 13.2
01h	OUT_P_MSB ^[1]	R	00h	Pressure data out MSB	Yes	Bits12 to 19 of 20-bit real-time pressure sample. Root pointer to pressure and temperature FIFO data.	02h	01h	Section 13.3
02h	OUT_P_CSB ^[1]	R	00h	Pressure data out CSB	Yes	Bits 4 to 11 of 20-bit real-time pressure sample	03	ßh	Section 13.3
03h	OUT_P_LSB ^[1]	R	00h	Pressure data out LSB	Yes	Bits 0 to 3 of 20-bit real-time pressure sample	04	lh	Section 13.3
04h	OUT_T_MSB ^[1]	R	00h	Temperature data out MSB	Yes	Bits 4 to 11 of 12-bit real-time temperature sample	05	ōh	Section 13.4
05h	OUT_T_LSB ^[1]	R	00h	Temperature data out LSB	Yes	Bits 0 to 3 of 12-bit real-time temperature sample	00)h	Section 13.4

[1] The Registers in Area A from 00h to 05h depend on the F_MODE bit setting in FIFO Setup Register (F_SETUP).

• F MODE = 00, FIFO is disabled.

• F_MODE = 01 is circular buffer.

• F_MODE = 10 is full stop mode.

I²C precision pressure sensor with altimetry

Table 12. Register address map: Area A (F_Mode > 0, FIFO in circular buffer or full stop mode)

Register Address	Name	Access	Reset value	Description	Reset when STBY to Active	Comment	Auto- increment address	Reference
00h/0Dh	F_STATUS ^[1]	R	00h	Sensor status register	Yes	F_STATUS	01h	Section 13.8.1
01h	F_DATA ^[1]	R	00h	FIFO 8-bit data access	Yes	-	01h	Section 13.8.2
02h	Read to reserved area returns 00 ^[1]	-	00h	_	n.a.	-	03h	-
03h	Read to reserved area returns 00 ^[1]	-	00h	—	n.a.	-	04h	-
04h	Read to reserved area returns 00 ^[1]	-	00h	_	n.a.	—	05h	_
05h	Read to reserved area returns 00 ^[1]	-	00h	_	n.a.	_	00h	_

[1] The registers in area A from 00h to 05h depend on the F_MODE bit setting in FIFO setup register (F_SETUP).

• F_MODE = 00, FIFO is disabled.

• F_MODE = 01 is circular buffer.

• F_MODE = 10 is full stop mode.

13.1 STATUS - sensor status register (address 00h)

The aliases allow the STATUS register to be read easily before reading the current pressure/altitude or temperature data, the delta pressure/altitude or temperature data, or the FIFO data, using the register address auto-incrementing mechanism.

Table 13. Alias for DR_Status (06h) or F_Status (0Dh) registers

FIFO data enabled mode bit setting	Status register alias
F_MODE = 00 ^[1]	00h = DR_STATUS (06h)
F_MODE >00	00h = F_STATUS (0Dh)

[1] The F_MODE is defined in <u>Section 13.8.3 " F_SETUP- FIFO setup register (address 0Fh)"</u>

13.2 DR_STATUS - status register (address 06h)

The DR_STATUS register provides the acquisition status information on a per sample basis, and reflects real-time updates to the OUT_P and OUT_T registers. The same STATUS register can be read through an alternate address 00h ($F_Mode = 00$).

Table 14. DR_STATUS - status register (address 06h) bit allocation

Bit	7	6	5	4	3	2	1	0
Symbol	PTOW	POW	TOW	reserved	PTDR	PDR	TDR	reserved
Reset	0	0	0	0	0	0	0	0
Access	R	R	R	R	R	R	R	R

MPL3115A2 Data sheet: Technical data

I²C precision pressure sensor with altimetry

Bit	Symbol	Description
7	PTOW ^[1]	 Pressure/altitude or temperature data overwrite. PTOW is set to 1 whenever new data is acquired before completing the retrieval of the previous set. This event occurs when the content of at least one data register (OUT_P, OUT_T) has been overwritten. PTOW is cleared when the high-bytes of the data (OUT_P_MSB or OUT_T_MSB) are read, when F_MODE is zero. PTOW is cleared by reading F_DATA register when F_MODE > 0. 0 — No data overwrite has occurred (reset value) 1 — Previous pressure/altitude or temperature data was overwritten by new pressure/altitude or temperature data before it was read
6	POW ^[2]	 Pressure/altitude data overwrite. POW is set to 1 whenever a new pressure/altitude acquisition is completed before the retrieval of the previous data. When this occurs the previous data is overwritten. POW is cleared anytime OUT_P_MSB register is read, when F_MODE is zero. POW is cleared by reading F_DATA register when F_MODE > 0. 0 — No data overwrite has occurred (reset value) 1 — Previous pressure/altitude data was overwritten by new pressure/altitude data before it was read
5	TOW ^[3]	 Temperature data overwrite. TOW is set to 1 whenever a new temperature acquisition is completed before the retrieval of the previous data. When this occurs the previous data is overwritten. TOW is cleared anytime OUT_T_MSB register is read, when F_MODE is zero. TOW is cleared by reading F_DATA register when F_MODE > 0. 0 — No data overwrite has occurred (reset value) 1 — Previous temperature data was overwritten by new temperature data before it was read
4	reserved	This bit is reserved
3	PTDR ^[1]	Pressure/altitude or temperature data ready. PTDR signals that a new acquisition for either pressure/altitude or temperature is available. PTDR is cleared anytime OUT_P_MSB or OUT_T_MSB register is read, when F_MODE is zero. PTDR is cleared by reading F_DATA register when F_MODE > 0. 0 — No new set of data ready (reset value) 1 — A new set of data is ready
2	PDR ^[2]	Pressure/altitude new data available. PDR is set to 1 whenever a new pressure/altitude data acquisition is completed. PDR is cleared anytime OUT_P_MSB register is read, when F_MODE is zero. PDR is cleared by reading F_DATA register when F_MODE > 0. 0 — No new pressure/altitude data is available (reset value) 1 — A new set of Pressure/Altitude data is ready
1	TDR ^[3]	Temperature new data available. TDR is set to 1 whenever a temperature data acquisition is completed. TDR is cleared anytime OUT_T_MSB register is read, when F_MODE is zero. TDR is cleared by reading F_DATA register when F_MODE > 0. 0 — No new temperature data ready (reset value) 1 — A new temperature data is ready
0	reserved	This bit is reserved

PTDR and PTOW flag generation requires the DREM event flag generator to be enabled in the PT data configuration register (PT_DATA_CFG).
 PDR and POW flag generation is required for the pressure/altitude event flag generator to be enabled (PDEFE = 1) in the PT data configuration register

[2] PDR and POW flag generation is required for the pressure/altitude event flag generator to be enabled (PDEFE = 1) in the PT data configuration register (PT_DATA_CFG).

[3] TDR and TOW flag generation is required for the temperature event flag generator to be enabled (TDEFE = 1) in the PT data configuration register (PT_DATA_CFG).

13.2.1 Data registers with F_MODE = 00 (FIFO disabled)

When the FIFO data output register, F_DATA (0Eh), is disabled (F_MODE[7:6] = 00 in the F_SETUP register, 0Fh), the pressure and altitude data registers indicate the real-

I²C precision pressure sensor with altimetry

time status information of the sample data. This data can be either altimeter or barometer data based on the mode defined by the ALT bit in the CTRL_REG1 register. See <u>Section</u> <u>13.8 "FIFO setup registers"</u> for additional information.

13.3 OUT_P_MSB, OUT_P_CSB, OUT_P_LSB - pressure and altitude data registers (address 01h, 02h, 03h)

Pressure and altitude data registers 01h, 02h and 03h comprise the pressure and altitude data depending on the setting of the ALT bit in the CTRL_REG1 register, in either altimeter or barometer mode. For example if the ALT bit is set (ALT = 1) then after acquisition the data stored in registers 01h, 02h and 03h is the altitude in meters. Otherwise the data stored in registers 01h, 02h and 03h (ALT = 0) is pressure data in Pascals.

The altitude data is stored as a 20-bit signed integer with a fractional part. The OUT_P_MSB (01h) and OUT_P_CSB (02h) registers contain the integer part in meters and the OUT_P_LSB (03h) register contains the fractional part. This value is represented as a Q16.4 fixed-point format where there are 16 integer bits (including the signed bit) and four fractional bits.

The pressure data is stored as a 20-bit unsigned integer with a fractional part. The OUT_P_MSB (01h), OUT_P_CSB (02h) and bits 7 to 6 of the OUT_P_LSB (03h) registers contain the integer part in Pascals. Bits 5 to 4 of OUT_P_LSB contain the fractional component. This value is representative as a Q18.2 fixed point format where there are 18 integer bits and two fractional bits.

Note: When a RAW bit is set in the CTRL_REG1 register then the RAW value is stored in all 24 bits of OUT_P_MSB, OUT_P_CSB and OUT_P_LSB registers whether in altimeter or barometer mode.

allocation												
Lo	cation		Bit									
Address	Register	7	7 6 5 4 3 2 1									
01h	OUT_P_MSB				PD[1	9:12]	•	·				
02h	OUT_P_CSB				PD[′	11:4]						
03h	OUT_P_LSB		PD[3:0]			rese	rved				
Reset		0	0 0 0 0 0 0 0									
Access		R	R	R	R	R	R	R	R			

Table 16. OUT_P_MSB, OUT_P_CSB, OUT_P_LSB - pressure and altitude data registers (address 01h, 02h, 03h) bit allocation

13.3.1 Data registers with F_MODE = 00

The DR_STATUS, OUT_P_MSB, OUT_P_CSB, OUT_P_LSB, OUT_T_MSB, and OUT_T_LSB registers are stored in the auto-incrementing address range of 00h to 05h. This allows the host controller to read the status register followed by the 20-bit pressure/ altitude and 12-bit temperature in a 6-byte I²C transaction.

See <u>Section 13.8 "FIFO setup registers"</u> for additional information.

I²C precision pressure sensor with altimetry

13.4 OUT_T_MSB, OUT_T_LSB - temperature data registers (address 04h, 05h)

The temperature data is stored as a signed 12-bit integer with a fractional part. The OUT_T_MSB (04h) register contains the integer part in °C and the OUT_T_LSB (05h) register contains the fractional part. This value is representative as a Q8.4 fixed point format where there are eight integer bits (including the signed bit) and four fractional bits.

Note: When the RAW bit is set in CTRL_REG1 is selected then the RAW temperature value is stored in all 16 bits of the OUT_T_MSB and OUT_T_LSB.

Table 17. OUI_I_MSB, OUI_I_LSB - temperature data registers (address 04h, 05h) bit allocation											
Lo	cation	Bit									
Address	Register	7	7 6 5 4 3 2 1								
04h	OUT_T_MSB				TD[1	11:4]					
05h	OUT_T_LSB		TD[3:0]			rese	rved			
Reset		0	0 0 0 0 0 0 0 0								
Access R R R R R R R						R					

Table 17. OUT_T_MSB, OUT_T_LSB - temperature data registers (address 04h, 05h) bit allocation

13.5 OUT_P_DELTA_MSB, OUT_P_DELTA_CSB, OUT_P_DELTA_LSB - pressure and altitude delta register (address 07h, 08h, 09h)

The pressure and altitude delta registers 07h, 08h and 09h comprise the pressure and altitude delta data and provide the differences from either the last pressure or altitude samples based on the setting of the ALT bit in the CTRL_REG1 register. Device can be in either altimeter or barometer mode.

The altitude data is arranged as a 20-bit signed integer with a fractional part. Stored as meters with the 16 bits of OUT_P_DELTA_MSB and OUT_P_DELTA_CSB and with fractions of a meter stored in four bits in position 7 to 4 of OUT_P_DELTA_LSB.

The pressure is arranged as a 20-bit unsigned integer with a fractional part in Pascals. The first 18 bits are located in OUT_P_DELTA_MSB, OUT_P_DELTA_CSB and bits 7 to 6 of OUT_P_DELTA_LSB. The two bits in position 5 to 4 of OUT_P_DELTA_LSB represent the fractional component.

In RAW mode, these registers are not used and their values are not updated.

Note: The OUT_P_DELTA register store the difference data information regardless of the state of the FIFO data output register driver bit, $F_MODE > 00$.

Location	7h, 08h, 09h) bit allocati Bit	on								
Address	Register	7	6	5	4	3	2	1	0	
07h	OUT_P_DELTA_MSB				PDD[19:12]				
08h	OUT_P_DELTA_CSB				PDD[[11:4]				
09h	OUT_P_DELTA_LSB		PDD[3:0] reserved							
Reset 0 0 0 0 0 0 0 0 0 0						0				

Table 18. OUT_P_DELTA_MSB, OUT_P_DELTA_CSB, OUT_P_DELTA_LSB - pressure and altitude delta register (address 07h, 08h, 09h) bit allocation

MPL3115A2

I²C precision pressure sensor with altimetry

Location	Bit								
Address	Register	7	6	5	4	3	2	1	0
Access		R	R	R	R	R	R	R	R

13.6 OUT_T_DELTA_MSB, OUT_T_DELTA_LSB - temperature delta register (address 0Ah, 0Bh)

The temperature delta register 0Ah and 0Bh comprise the temperature delta data and provide the difference from the last temperature samples.

The temperature data is arranged as 12-bit signed integer with a fractional part in °C. The eight bits of OUT_T_DELTA_MSB representing degrees and with fractions of a degree stored in four bits in position 7 to 4 of OUT_T_DELTA_LSB.

In RAW mode, these registers are not used and their values are not updated.

Note: The OUT_T_DELTA register store the difference data information regardless of the state of the FIFO data output register driver bit, F_MODE > 00.

Table 19. OUT_T_DELTA_MSB, OUT_T_DELTA_LSB - temperature delta register (address 0Ah, 0Bh) bit allocation

	Location				B	it				
Address	Register	7	6	5	4	3	2	1	0	
0Ah	OUT_T_DELTA_MSB				TDD	[11:4]	·			
0Bh	OUT_T_DELTA_LSB		TDD[3:0] reserved							
Reset		0	0	0	0	0	0	0	0	
Access		R	R	R	R	R	R	R	R	

13.7 WHO_AM_I - device ID register (address 0Ch)

This register contains the device identifier which is set to C4h by default. The value is factory programmed. Consult the NXP factory for custom alternate values.

Table 20. WHO_AM_I - device ID register (address 0Ch) bit allocation

		V	<u> </u>					
Bit	7	6	5	4	3	2	1	0
Symbol				WHO_A	M_I[7:0]			
Reset	0	0	0	0	0	0	0	0
Access	NVM data 1	NVM data 1	NVM data 0	NVM data 0	NVM data 0	NVM data 1	NVM data 0	NVM data 0

13.8 FIFO setup registers

13.8.1 F_STATUS - FIFO status register (address 0Dh)

Table 21. F_STATUS - FIFO status register (address 0Dh) bit allocation

Bit	7	6	5	4	3	2	1	0
Symbol	F_OVF	F_WMRK_FLAG	F_CNT[5:0]					
MPI 3115A2	All information provided in this document is subject to legal disclaimers						© NXP B.V. 20	17. All rights reserved

Data sheet: Technical data

I²C precision pressure sensor with altimetry

Bit	7	6	5	4	3	2	1	0
Reset	0	0	0	0	0	0	0	0
Access	R	R	R	R	R	R	R	R

Table 22. F_STATUS - FIFO status register (address 0Dh) bit description

F_OVF	F_WMRK_FLAG	Event description
0		No FIFO overflow events detected.
1		FIFO overflow event detected.
—	0	No FIFO watermark events detected.
_	1	FIFO watermark event detected. FIFO sample count greater than watermark value

The F_OVF and F_WMRK_FLAG flags remain asserted while the event source is still active, but the user can clear the FIFO interrupt bit flag in the interrupt source register (INT_SOURCE) by reading the F_STATUS register. Therefore, the F_OVF bit flag will remain asserted while the FIFO has overflowed and the F_WMRK_FLAG bit flag will remain asserted while the F_CNT value is greater than then F_WMRK value.

Table 23. F_STATUS - FIFO status register (address 0Dh) bit description

Bit	Symbol	Description
5 to 0	F_CNT	 FIFO sample counter. F_CNT[5:0] bits indicate the number of samples currently stored in the FIFO buffer. 00_0000 — indicates that the FIFO is empty (reset value) 00_0001 to 10_0000 — indicates 1 to 32 samples stored in FIFO

13.8.2 F_DATA - FIFO data register (address 0Eh)

F_DATA is a read only address which provides access to 8-bit FIFO data. FIFO holds a maximum of 32 samples, a maximum of $5 \times 32 = 160$ data bytes of samples can be read. When F_MODE bit in FIFO SETUP (F_SETUP) register is set to logic '1', the F_DATA pointer shares the same address location as OUT_P_MSB (01h), therefore all accesses of the FIFO buffer data use the I²C address 01h. Reads from the other data registers (02h, 03h, 04h, 05h) will return a value of 00h.

Note: The FIFO will NOT suspend to data accumulation during read transactions to *F_DATA*.

Bit	7	6	5	4	3	2	1	0
Symbol	F_DATA[7:0]							
Reset	0	0	0	0	0	0	0	0
Access	R	R	R	R	R	R	R	R

Table 24. F_DATA - FIFO data register (address 0Eh) bit allocation

MPL3115A2 Data sheet: Technical data

I²C precision pressure sensor with altimetry

OUT_P_MSB (oldest)
OUT_P_CSB (oldest)
OUT_P_LSB (oldest)
OUT_T_MSB (oldest)
OUT_T_LSB (oldest)
·
OUT_T_LSB (oldest)
00h
00h

13.8.3 F_SETUP- FIFO setup register (address 0Fh)

A FIFO sample count exceeding the watermark event does not stop the FIFO from accepting new data.

The FIFO update rate is dictated by the selected system acquisition rate (ST bits of CTRL_REG2).

When a byte is read from the FIFO buffer the oldest sample data in the FIFO buffer is returned and also deleted from the front of the FIFO buffer, while the FIFO sample count is decremented by one. It is assumed that the host application shall use the I^2C BURST read transaction to dump the FIFO.

Bit	7	6	5	4	3	2	1	0	
Symbol	F_MODE[1:0]		F_WMRK[5:0]						
Reset	0	0	0	0	0	0	0	0	
Access	R	R	R	R	R	R	R	R	

Table 26. F_SETUP- FIFO setup register (address 0Fh) bit allocation

I²C precision pressure sensor with altimetry

Table 2	Table 27. F_SETUP- FIFO setup register (address 0Fh) bit description								
Bit	Symbol	Description							
7 to 6	F_MODE[7:6] ^{[1][2]}	 FIFO buffer overflow mode. 00 — FIFO is disabled (reset value) 01 — FIFO contains the most recent samples when overflowed (circular buffer). Oldest sample is discarded to be replaced by new sample 10 — FIFO stops accepting new samples when overflowed 11 — Not used The FIFO is flushed whenever the FIFO is disabled, or transitioning from STANDBY mode to ACTIVE mode. Disabling the FIFO (F_MODE = 00) resets the F_OVF, F_WMRK_FLAG, F_CNT to zero. A FIFO overflow event (as when F_CNT = 32) will assert the F_OVF flag and a FIFO sample count equal to the sample count watermark (F_WMRK) asserts the F_WMRK_FLAG event flag. To switch between FIFO modes, first disable the FIFO and then write the new value to F_MODE. 							
5 to 0	F_WMRK[5:0] ^[3]	FIFO event sample count watermark. These bits set the number of FIFO samples required to trigger a watermark interrupt. A FIFO watermark event flag (F_WMRK_FLAG) is raised when FIFO sample count F_CNT[5:0] value is equal to the F_ WMRK[5:0] watermark. 00_0000 — FIFO is disabled (reset value) Setting the F_WMRK[5:0] to 00_0000 will disable the FIFO watermark event flag generation.							

This bit field can be written in ACTIVE mode. [1]

This bit field can be written in STANDBY mode.

[2] [3] The FIFO mode (F_MODE) cannot be switched between the two operational modes (01 and 10).

13.9 TIME_DLY - time delay register (address 10h)

The time delay register contains the number of ticks of data sample time since the last byte of the FIFO was written. This register starts to increment on FIFO overflow or data wrap and clears when the last byte of FIFO is read.

Table 28. TIME	DLY - time dela	y register (address	10h) bit allocation

Bit	7	6	5	4	3	2	1	0	
Symbol		TD[7:0]							
Reset	0	0	0	0	0	0	0	0	
Access	R	R	R	R	R	R	R	R	

13.10 SYSMOD - system mode register (address 11h)

Bit	7	6	5	4	3	2	1	0
Symbol	reserved							SYSMOD
Reset	0	0	0	0	0	0	0	0
Access	R	R	R	R	R	R	R	R

Table 30. SYSMOD - system mode register (address 11h) bit description

Bit	Symbol	Description	
7 to 1	reserved	These bits are reserved and will always read 0	
MPL3115A2		All information provided in this document is subject to legal disclaimers.	© NXP B.V. 2017. All rights reserved.

I²C precision pressure sensor with altimetry

Bit	Symbol	Description
0	SYSMOD	System mode 0 — STANDBY mode (reset value) 1 — ACTIVE mode

13.11 INT_SOURCE - system interrupt status register (address 12h)

The interrupt source register bits that are set (logic '1') to indicate which function has asserted its interrupt and conversely, bits that are cleared (logic '0') indicate which function has not asserted its interrupt.

The setting of the bits is rising edge sensitive, the bit is set by a low to high state change and reset by reading the appropriate source register.

Table 31. INT_SOURCE - system interrupt status register (address 12h) bit allocation

Bit	7	6	5	4	3	2	1	0
Symbol	SRC_DRDY	SRC_FIFO	SRC_PW	SRC_TW	SRC_PTH	SRC_TTH	SRC_PCHG	SRC_TCHG
Reset	0	0	0	0	0	0	0	0
Access	R	R	R	R	R	R	R	R

Table 32. INT_SOURCE - system interrupt status register (address 12h) bit description Bit Symbol

Bit	Symbol	Description
7	SRC_DRDY	Data ready interrupt status bit. Logic '1' indicates that pressure/altitude or temperature data ready interrupt is active indicating the presence of new data and/or a data overwrite, otherwise it is a logic '0'. This bit is asserted when the PTOW and/or PTDR is set and the functional block interrupt has been enabled. This bit is cleared by reading the STATUS and pressure/temperature register.
6	SRC_FIFO	 FIFO interrupt status bit. Logic '1' indicates that a FIFO interrupt event such as an overflow event has occurred. FIFO interrupt event generators: FIFO overflow, or (watermark: F_CNT = F_WMRK). 0 — no FIFO interrupt event has occurred. (reset value) This bit is cleared by reading the F_STATUS register. 1 — A FIFO interrupt event such as an overflow event has occurred.
5	SRC_PW	 Altitude/pressure alerter status bit near or equal to target pressure/altitude (near is within target value ± window value). 0 — (reset value) Window value needs to be non zero for interrupt to trigger.
4	SRC_TW	Temperature alerter status bit near or equal to target temperature (near is within target value ± window value.) 0 — (reset value) Window value needs to be non zero for interrupt to trigger.
3	SRC_PTH	 Altitude/pressure threshold interrupt. 0 — If the window is set to 0, it will only trigger on crossing the center threshold. (reset value) 1 — With the window set to a non zero value, the trigger will occur on crossing any of the thresholds: upper, center or lower.

I²C precision pressure sensor with altimetry

Bit	Symbol	Description
2	SRC_TTH	Temperature threshold interrupt. 0 — If the window is set to 0, it will only trigger on crossing the center threshold.(reset value) 1 — With the window set to a non zero value, the trigger will occur on crossing any of the thresholds: upper, center or lower.
1	SRC_PCHG	Delta P interrupt status bit. 0 — (reset value)
0	SRC_TCHG	Delta T interrupt status bit. 0 — (reset value)

13.12 PT_DATA_CFG - sensor data register (address13h)

The PT_DATA_CFG register configures the pressure data, temperature data and event flag generator.

Table 33. PT_DATA_CFG - sensor data register (address13h) bit allocation

Bit	7	6	5	4	3	2	1	0
Symbol			DREM	PDEFE	TDEFE			
Reset	0	0	0	0	0	0	0	0
Access	R	R	R	R	R	R	R	R

Table 34. PT_DATA_CFG - sensor data register (address13h) bit description

Bit	Symbol	Description
7 to 3	reserved	These bits are reserved
2	DREM	 Data ready event mode. 0 — Event detection disabled (reset value) If the DREM bit is cleared logic '0' and one or more of the data ready event flags are enabled, then an event flag will be raised whenever the system acquires a new set of data. 1 — Generate data ready event flag on new pressure/altitude or temperature data. If the DREM bit is set logic '1' and one or more of the data ready event flags (PDEFE, TDEFE) are enabled, then an event flag will be raised upon change in state of the data.
1	PDEFE	Data event flag enable on new pressure/altitude 0 — Event detection disabled (reset value) 1 — Raise event flag on new pressure/altitude data
0	TDEFE	Data event flag enable on new temperature data. 0 — Event detection disabled (reset value) 1 — Raise event flag on new temperature data

13.13 BAR_IN_MSB, BAR_IN_LSB - barometric pressure input register (address 14h, 15h)

Barometric input for altitude calculations. Input is equivalent to sea level pressure for measurement location. Value is input in two Pa units.

Units are input as unsigned 16-bit integers. The default value is 101,326 Pa. The default value can be changed by writing to this register.

I²C precision pressure sensor with altimetry

Location					В	it					
Address	Register	7	7 6 5 4 3 2 1 0								
14h	BAR_IN_MSB		BAR[15:8]								
15h	BAR_IN_LSB				BAR	[7:0]					
Reset MSE	3	1	1	0	0	0	1	0	1		
Reset LSB 1 1			1	1	0	0	1	1	1		
Access R/W R/W			R/W	R/W	R/W	R/W	R/W	R/W			

Table 35. BAR_IN_MSB, BAR_IN_LSB - barometric pressure input register (address 14h, 15h) bit allocation

13.14 P_TGT_MSB, P_TGT_LSB - pressure/altitude target value register (address 16h, 17h)

Altitude or pressure target value.

Depending on the setting of the ALT bit in the CTRL_REG1 register, in operates in either altimeter or barometer mode. This value works in conjunction with the window value (P_WND_MSB and P_WND_LSB). In altitude mode, the register value is 16-bit signed integer in meters.

In pressure mode, the value is a 16-bit unsigned value in two Pa units.

Table 36. P_TGT_MSB, P_TGT_LSB - pressure/altitude target value register (address 16h, 17h) bit allocation									
Lo	cation				В	it			
Address	Register	7	7 6 5 4 3 2 1 0						
16h	P_TGT_MSB				P_TG	T[15:8]			
17h	P_TGT_LSB				P_TG	T[7:0]			
Reset 0			0	0	0	0	0	0	0
Access R/W			R/W	R/W	R/W	R/W	R/W	R/W	R/W

13.15 T_TGT- temperature target value register (address 18h)

Temperature target value is input as an 8-bit signed integer in °C.

Table 27 T TOT tom	ware to wat the	lue verieter (eddrees	40h) hit alle setion
Table 37. T_TGT- tem	perature target va	liue register (address	Ton) bit anocation

Bit	7	6	5	4	3	2	1	0			
Symbol		T_TGT[7:0]									
Reset	0	0	0	0	0	0	0	0			
Access	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W			

13.16 P_WND_LSB, P_WND_MSB - pressure/altitude window value register (address 19h, 1Ah)

Pressure or altitude window value register is arranged as an unsigned 16-bit integer of window value in meters or in two Pa units, depending on either altimeter or barometer mode.

I²C precision pressure sensor with altimetry

Table 66.1 _ MAD_LOD, 1 _ MAD_MOD * pressure/antitade window value register (address 1611, 1AI) bit anotation									
Lo	cation			В	it				
Address	Register	7	6 5 4 3 2 1 0						
19h	P_WND_LSB				P_W	[15:8]			
1Ah	P_WND_MSB				P_W	[7:0]			
Reset 0			0	0	0	0	0	0	0
Access R/W			R/W	R/W	R/W	R/W	R/W	R/W	R/W

Table 38. P_WND_LSB, P_WND_MSB - pressure/altitude window value register (address 19h, 1Ah) bit allocation

13.17 T_WIN- temperature window value register (address 18h)

The temperature alarm window value register is an unsigned 8-bit value in °C.

Table 39. T	WIN- temperature	window value regi	ster (address 18h) bit allocation

Bit	7	6	5	4	3	2	1	0	
Symbol		T_WIN[7:0]							
Reset	0	0	0	0	0	0	0	0	
Access	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W	

13.18 P_MIN_MSB, P_MIN_CSB, P_MIN_LSB - minimum pressure or altitude register (address 1Ch, 1Dh, 1Eh)

Register with captured minimum pressure or altitude value.

The altitude data is arranged as a 20-bit signed integer in meters. The first 16 bits are located in P_MIN_MSB and P_MIN_CSB. Fractions of a meter are stored in four bits in position 7 to 4 of P_MIN_LSB.

The pressure is arranged as a 20-bit unsigned data in Pascals. The first 18 bits are located in P_MIN_MSB, P_MIN_CSB and bits 7 to 6 of P_MIN_LSB. The two bits in position 5 to 4 of P_MIN_LSB represent the fractional component.

The register is cleared on power-up or manually by writing '0' to the register.

Location		Bit								
Address	Register	7	6	5	4	3	2	1	0	
1Ch	P_MIN_MSB		P_MIN[19:12]					1		
1Dh	P_MIN_CSB		P_MIN[11:4]							
1Eh	P_MIN_LSB		P_MI	N[3:0]			rese	rved		
Reset		0	0	0	0	0	0	0	0	
Access MSB Access CSB Access LSB		R/W R/W R/W	R/W R/W R/W	R/W R/W R/W	R/W R/W R/W	R/W R/W R	R/W R/W R	R/W R/W R	R/W R/W R	

Table 40. P_MIN_MSB, P_MIN_CSB, P_MIN_LSB - minimum pressure or altitude register (address 1Ch, 1Dh, 1Eh) bit allocation

MPL3115A2 Data sheet: Technical data

13.19 P_MAX_MSB, P_MAX_CSB, P_MAX_LSB - maximum pressure or altitude register (address 21h, 22h, 23h)

Register with captured maximum pressure or altitude value.

The altitude data is arranged as a 20-bit signed integer in meters. The first 16 bits are located in P_MAX_MSB and P_MAX_CSB. Fractions of a meter stored in four bits in position 7 to 4 of P_MAX_LSB.

The pressure is arranged as a 20-bit unsigned data in Pascals. The first 18 bits are located in P_MAX_MSB, P_MAX_CSB and bits 7 to 6 of P_MAX_LSB. The two bits in position 5 to 4 of P_MAX_LSB represent the fractional component.

The register is cleared on power-up or manually by writing '0' to the registers.

Table 41. P_MAX_MSB, P_MAX_CSB, P_MAX_LSB - maximum pressure or altitude register (address 21h, 22h, 23h) bit allocation

Location			Bit							
Address	Register	7	6	5	4	3	2	1	0	
21h	P_MAX_MSB		P_MAX[19:12]							
22h	P_MAX_CSB		P_MAX[11:4]							
23h	P_MAX_LSB		P_MA	X[3:0]			rese	rved		
Reset		0	0	0	0	0	0	0	0	
Access MS	Access MSB		R/W	R/W	R/W	R/W	R/W	R/W	R/W	
Access CSB		R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W	
Access LSB		R/W	R/W	R/W	R/W	R	R	R	R	

13.20 T_MIN_MSB, T_MIN_LSB - minimum temperature register (address 1Fh, 20h)

Register with captured minimum temperature value.

The temperature data is arranged as a 12-bit signed integer in °C. The first eight bits are located in T_MIN_MSB with fractions of a degree stored in four bits in position 7 to 4 of T_MIN_LSB.

The register is cleared on power-up or manually by writing '0' to the registers.

Table 42. T_MIN_MSB, T_MIN_LSB - minimum temperature register (address 1Fh, 20h) bit allocation

Location		Bit							
Address	Register	7	6	5	4	3	2	1	0
1Fh	T_MIN_MSB		T_MIN[11:4]						
20h	T_MIN_LSB		T_MIN[3:0] reserved						
Reset		0	0	0	0	0	0	0	0
Access MSB Access LSB		R/W R/W	R/W R/W	R/W R/W	R/W R/W	R/W R	R/W R	R/W R	R/W R

MPL3115A2 Data sheet: Technical data

I²C precision pressure sensor with altimetry

13.21 T_MAX_MSB, T_MAX_LSB - maximum temperature register (address 24h, 25h)

Register with captured maximum temperature value.

The temperature data is arranged as a 12-bit signed integer in °C. The first eight bits are located in T_MAX_MSB with fractions of a degree stored in four bits in position 7 to 4 of T_MAX_LSB.

The register is cleared on power-up or manually by writing '0' to the registers

Table 43. T	_MAX_MSB, T_I	MAX_LSB -	minimum t	emperature	e register (a	ddress 24h	, 25h) bit all	ocation	
Lo	cation		Bit						
Address	Register	7	6	5	4	3	2	1	0
24h	T_MAX_MSB		T_MAX[11:4]						
25h	T_MAX_LSB		T_MA	X[3:0]			rese	rved	
Reset		0	0	0	0	0	0	0	0
Access MSB Access LSB		R/W R/W	R/W R/W	R/W R/W	R/W R/W	R/W R	R/W R	R/W R	R/W R

13.22 Control registers

13.22.1 CTRL_REG1 - control register 1 (address 26h)

Note: Except for STANDBY and OST mode selection, the device must be in STANDBY mode to change any of the fields within bits 7 to 0 of CTRL_REG1 (26h).

Table 44. CTRL_REG1 - control register 1 (address 26h) bit allocation

Bit	7	6	5	4	3	2	1	0
Symbol	ALT	RAW		OS[2:0]		0 (R) RST (W)	OST	SBYB
Reset	0	0	0	0	0	0	0	0
Access	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W

Table 45. CTRL_REG1 - control register 1 (address 26h) bit description

Bit	Symbol	Description
7	ALT	Altimeter/barometer mode. 0 — Part is in barometer mode (reset value) 1 — Part is in altimeter mode
6	RAW	RAW output mode. RAW bit will output ADC data with no post processing, except for oversampling. No scaling or offsets will be applied in the digital domain. The FIFO must be disabled and all other functionality including alarms, deltas, and other interrupts are disabled.
5 to 3	OS[2:0]	Oversample ratio. These bits select the oversampling ratio. Value is 2 ^{OS} . The default value is 000 for a ratio of 1.

MPL3115A2

I²C precision pressure sensor with altimetry

Bit	Symbol	Description
2	0 (R) RST (W)	 Software reset. This bit is used to activate the software reset. The boot mechanism can be enabled in STANDBY and ACTIVE mode. When the boot bit is enabled the boot mechanism resets all functional block registers and loads the respective internal registers with default values. If the system was already in STANDBY mode, the reboot process will immediately begin, or else if the system was in ACTIVE mode, the boot mechanism will automatically transition the system from ACTIVE mode to STANDBY mode. Only then can the reboot process begin. The I²C communication system is reset to avoid accidental corrupted data access. At the end of the boot process the RST bit is de-asserted to 0. Reading this bit will return a value of zero. 0 — Device reset disabled (reset value) 1 — Device reset enabled
1	OST	OST bit will initiate a measurement immediately. If the SBYB bit is set to active, setting the OST bit will initiate an immediate measurement, the part will then return to acquiring data as per the setting of the ST bits in CTRL_REG2. In this mode, the OST bit does not clear itself and must be cleared and set again to initiate another immediate measurement. In one-shot mode, when SBYB is 0, the OST bit is an auto-clear bit. When OST is set, the device initiates a measurement by going into active mode. Once a pressure/altitude and temperature measurement is completed, it clears the OST bit and comes back to STANDBY mode. User shall read the value of the OST bit before writing to this bit again.
0	SBYB	This bit is sets the mode to ACTIVE, where the system will make measurements at periodic times based on the value of ST bits. 0 — Part is in STANDBY mode (reset value) 1 — Part is ACTIVE

Table 46. System output sample rate selection

OS2	OS1	OS0	Oversample ratio	Minimum time between data samples
0	0	0	1	6 ms
0	0	1	2	10 ms
0	1	0	4	18 ms
0	1	1	8	34 ms
1	0	0	16	66 ms
1	0	1	32	130 ms
1	1	0	64	258 ms
1	1	1	128	512 ms

Note: The RAW bit overrides the ALT mode and writes uncompensated pressure and temperature data.

I²C precision pressure sensor with altimetry

13.22.2 CTRL_REG2 - control register 2 (address 27h)

Table 47. CTRL_REG2 - control register 2 (address 27h) bit allocation

Bit	7	6	5	4	3	2	1	0	
Symbol	reserved		LOAD_OUTPUT	ALARM_SEL	ST[3:0]				
Reset	0	0	0	0	0	0	0	0	
Access	R	R	R/W	R/W	R/W	R/W	R/W	R/W	

Table 48. CTRL_REG2 - control register 2 (address 27h) bit description

Bit	Symbol	Description
7 to 6	reserved	These bits are reserved.
5	LOAD_OUTPUT	 This is to load the target values for SRC_PW/SRC_TW and SRC_PTH/SRC_TTH. 0 — Do not load OUT_P/OUT_T as target values (reset value) 1 — The next values of OUT_P/OUT_T are used to set the target values for the interrupts. Notes: This bit must be set at least once if ALARM_SEL=1 To reload the next OUT_P/OUT_T as the target values, clear and set again.
4	ALARM_SEL	The bit selects the target value for SRC_PW/SRC_TW and SRC_PTH/SRC_TTH. 0 — (reset value) The values in P_TGT_MSB, P_TGT_LSB and T_TGT are used. 1 — The values in OUT_P/OUT_T are used for calculating the interrupts SRC_PW/SRC_TW and SRC_PTH/SRC_TTH.
3 to 0	ST[3:0]	Auto acquisition time step. 0 — (reset value) Step value is 2ST — Giving a range of 1 second to 215 seconds (9 hours)

13.22.3 CTRL_REG3 - interrupt CTRL register (address 28h)

Table 49. CTRL_REG3 - interrupt CTRL register (address 28h) bit allocation								
Bit	7	6	5	4	3	2	1	0
Symbol	reserved		IPOL1	PP_OD1	reserved		IPOL2	PP_OD2
Reset	0	0	0	0	0	0	0	0
Access	R	R	R/W	R/W	R	R	R/W	R/W

Table 50. CTRL_REG3 - interrupt CTRL register (address 28h) bit description

Bit	Symbol	Description
7 to 6	reserved	These bits are reserved.
5	IPOL1	The IPOL bit selects the polarity of the interrupt signal. When IPOL is '0' (default value) any interrupt event will signalled with a logical '0'. Interrupt Polarity active high, or active low on interrupt pad INT1. 0 — Active low (reset value) 1 — Active high

I²C precision pressure sensor with altimetry

Bit	Symbol	Description
4	PP_OD1	 This bit configures the interrupt pin to push-pull or in open drain mode. The default value is 0 which corresponds to push-pull mode. The open drain configuration can be used for connecting multiple interrupt signals on the same interrupt line. push-pull/open drain selection on interrupt pad INT1. 0 — Internal pullup (reset value) 1 — Open drain
3 to 2	reserved	These bits are reserved.
1	PP_OD2	Interrupt polarity active high, or active low on interrupt pad INT2. 0 — Active low (reset value) 1 — Active high
0	PP_OD2	Push-pull/open drain selection on interrupt pad INT2. 0 — Internal pullup (reset value) 1 — Open drain

13.22.4 CTRL_REG4 - interrupt enable register (address 29h)

The corresponding functional block interrupt enable bit allows the functional block to route its event detection flags to the system's interrupt controller. The interrupt controller routes the enabled functional block interrupt to the INT1 or INT2 pin.

Table 51. CTRL_REG4 - Interrupt enable register (address 29h) bit allocation								
Bit	7	6	5	4	3	2	1	0
Symbol	INT_EN_DRDY	INT_EN_FIFO	INT_EN_PW	INT_EN_TW	INT_EN_PTH	INT_EN_TTH	INT_EN_PCHG	INT_EN_TCHG
Reset	0	0	0	0	0	0	0	0
Access	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W

Table 51. CTRL REG4 - interrupt enable register (address 29h) bit allocation

Table 52. CTRL_REG4 - interrupt enable register (address 29h) bit description

Bit	Symbol	Description
7	INT_EN_DRDY	Interrupt enable. 0 — Data ready interrupt disabled (reset value) 1 — Data ready interrupt enabled
6	INT_EN_FIFO	Interrupt enable. 0 — FIFO interrupt disabled (reset value) 1 — FIFO interrupt enabled
5	INT_EN_PW	Interrupt enable. 0 — Pressure window interrupt disabled (reset value) 1 — Pressure window interrupt enabled
4	INT_EN_TW	Interrupt enable. 0 — Temperature window interrupt disabled (reset value) 1 — Temperature window interrupt enabled
3	INT_EN_PTH	Interrupt enable. 0 — Pressure threshold interrupt disabled (reset value) 1 — Pressure threshold interrupt enabled

NXP Semiconductors

MPL3115A2

I²C precision pressure sensor with altimetry

Bit	Symbol	Description
2	INT_EN_TTH	Interrupt enable. 0 — Temperature threshold interrupt disabled (reset value) 1 — Temperature threshold interrupt enabled
1	INT_EN_PCHG	Interrupt enable. 0 — Pressure change interrupt disabled (reset value) 1 — Pressure change interrupt enabled
0	INT_EN_TCHG	Interrupt enable. 0 — Temperature change interrupt disabled (reset value) 1 — Temperature change interrupt enabled

13.22.5 CTRL_REG5 - interrupt configuration register (address 2Ah)

Table 53. CTRL_REG5 - interrupt configuration register (address 2Ah) bit allocation

Bit	7	6	5	4	3	2	1	0
Symbol	INT_CFG_DRDY	INT_CFG_FIFO	INT_CFG_PW	INT_CFG_TW	INT_CFG_PTH	INT_CFG_TTH	INT_CFG_PCHG	INT_CFG_TCHG
Reset	0	0	0	0	0	0	0	0
Access	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W

Table 54. CTRL_REG5 - interrupt configuration register (address 2Ah) bit description

Bit	Symbol	Description
7	INT_EN_DRDY	 INT1/INT2 configuration. 0 — Interrupt is routed to INT2 pin (reset value) 1 — Interrupt is routed to INT1
6	INT_CFG_FIFO	 INT1/INT2 configuration. 0 — Interrupt is routed to INT2 pin (reset value) 1 — Interrupt is routed to INT1
5	INT_CFG_PW	 INT1/INT2 configuration. 0 — Interrupt is routed to INT2 pin (reset value) 1 — Interrupt is routed to INT1
4	INT_CFG_TW	 INT1/INT2 configuration. 0 — Interrupt is routed to INT2 pin (reset value) 1 — Interrupt is routed to INT1
3	INT_CFG_PTH	 INT1/INT2 configuration. 0 — Interrupt is routed to INT2 pin (reset value) 1 — Interrupt is routed to INT1
2	INT_CFG_TTH	 INT1/INT2 configuration. 0 — Interrupt is routed to INT2 pin (reset value) 1 — Interrupt is routed to INT1
1	INT_CFG_PCHG	 INT1/INT2 configuration. 0 — Interrupt is routed to INT2 pin (reset value) 1 — Interrupt is routed to INT1

NXP Semiconductors

MPL3115A2

I²C precision pressure sensor with altimetry

Bit	Symbol	Description
0		INT1/INT2 configuration. 0 — Interrupt is routed to INT2 pin (reset value) 1 — Interrupt is routed to INT1


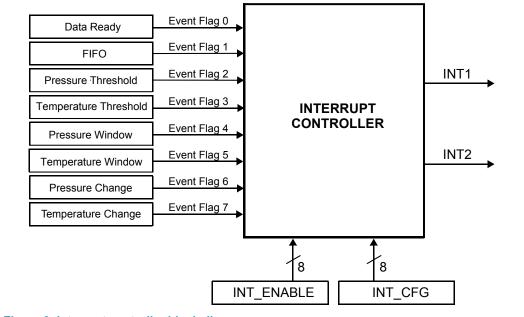


Figure 9. Interrupt controller block diagram

The system's interrupt controller uses the corresponding bit field in the CTRL_REG5 register to determine the routing table for the INT1 and INT2 interrupt pins. If the bit value is logic '0' the functional block's interrupt is routed to INT2, and if the bit value is logic '1' then the interrupt is routed to INT1.

All interrupts routed to INT1 or INT2 are logically OR'd as illustrated in <u>Figure 10</u>. One or more functional blocks can assert an interrupt pin simultaneously, therefore a host application responding to an interrupt should read the INT_SOURCE register to determine the appropriate sources of the interrupt.

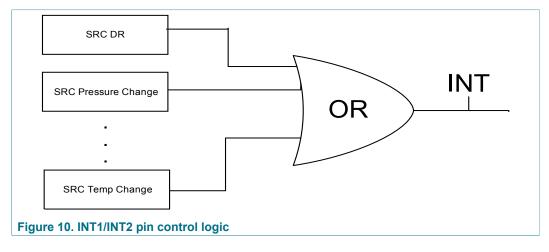

13.23 Offset correction registers

The 2's complement offset correction registers values are used to trim the temperature, altitude and pressure offsets that might occur over the life of the product.

13.23.1 OFF_P - offset pressure correction register (address 2Bh)

Pressure user accessible offset trim value expressed as an 8-bit, 2's complement number. The user offset registers may be adjusted to enhance accuracy and optimize the system performance. Range is from -512 to +508 Pa, 4 Pa/LSB.

				,				
Bit	7	6	5	4	3	2	1	0
Symbol		OFF_P[7:0]						
Reset	0	0	0	0	0	0	0	0
Access	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W

Table 55. OFF_P - offset correction register (address 2Bh) bit allocation

13.23.2 OFF_T - offset temperature correction register (address 2Ch)

Temperature user accessible offset trim value expressed as an 8-bit, 2's complement number. The user offset registers may be adjusted to enhance accuracy and optimize the system performance. Range is from -8 to +7.9375 °C, 0.0625 °C/LSB.

	· · · · · · · · · · · · · · · · · ·							
Bit	7	6	5	4	3	2	1	0
Symbol		OFF_T[7:0]						
Reset	0	0	0	0	0	0	0	0
Access	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W

Table 56. OFF_P - offset temperature correction register (address 2Ch) bit allocation

13.23.3 OFF_H - altitude data user offset register (address 2Dh)

Altitude data user offset register (OFF_H) is expressed as a 2's complement number in meters. See <u>Section 8.1.3 "Pressure/altitude"</u>. The user offset register provides user adjustment to the vertical height of the altitude output. The range of values are from -128 to +127 meters.

Bit	7	6	5	4	3	2	1	0
Symbol		OFF_H[7:0]						
Reset	0	0	0	0	0	0	0	0
Access	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W


MPL3115A2 Data sheet: Technical data

I²C precision pressure sensor with altimetry

14 Package information

14.1 Package dimensions

This drawing is located at <u>http://nxp.com/files/shared/doc/</u>package_info/98ASA00260D.pdf.

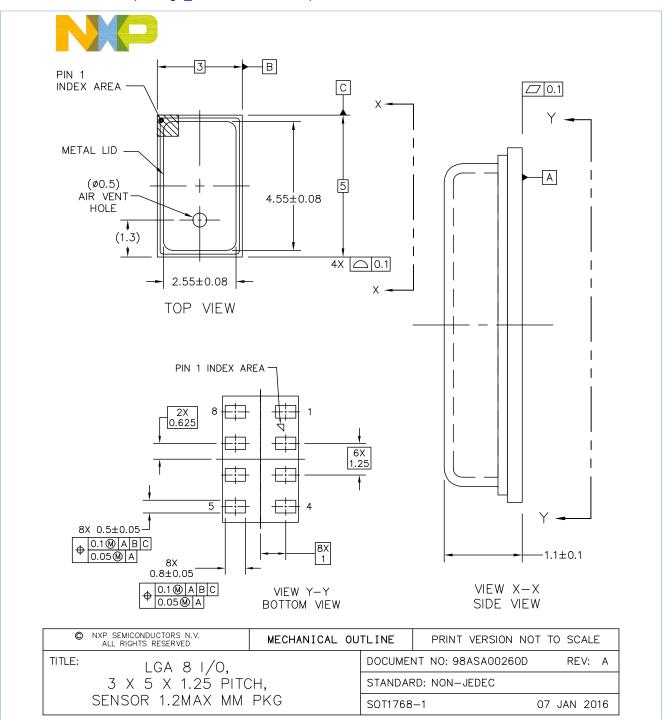

© NXP B.V. 2017. All rights reserved.

I²C precision pressure sensor with altimetry

	NP				
	NOTES:				
	1. ALL DIMENSIONS IN MILLI	METERS.			
	2. DIMENSIONING AND TOLERA	NCING PER ASME	′14.5M-1	994	
	3. STYLE: PIN 1: VDD PIN 5: PIN 2: CAP PIN 6: PIN 3: GND PIN 7: PIN 4: VDDIO PIN 8:	INT1 SDA			
	NXP SEMICONDUCTORS N.V. ALL RIGHTS RESERVED	MECHANICAL OU	TLINE	PRINT VERSION NOT	TO SCALE
	TITLE: LGA 8 I/O,		DOCUMENT NO: 98ASA00260D		REV: A
	3 X 5 X 1.25 PITC		STANDARD: NON-JEDEC		
	SENSOR 1.2MAX MM	PKG	SOT1768-1		7 JAN 2016
Figure	11. Case 98ASA00260D, LGA packag	ge			


15 Soldering/landing pad information

The LGA package is compliant with the RoHS standard.


Note: Pin 1 index area marker does not have any internal electrical connections. Handling and soldering recommendations for pressure sensors are available in application notes AN1984 and AN3150.

NXP Semiconductors

I²C precision pressure sensor with altimetry

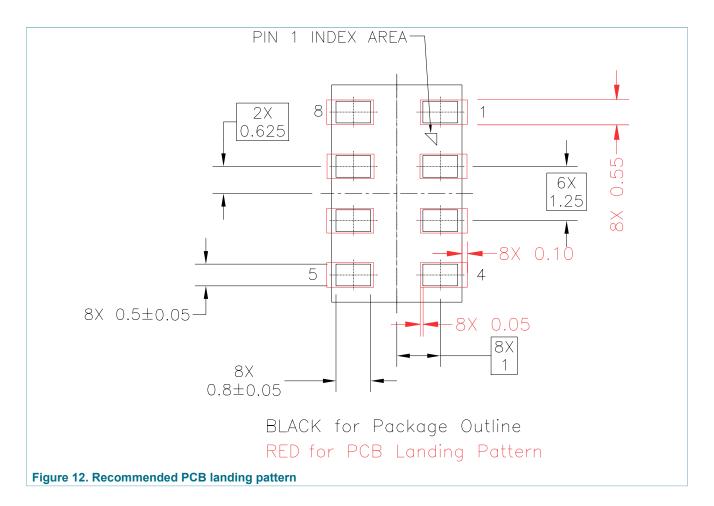

I²C precision pressure sensor with altimetry

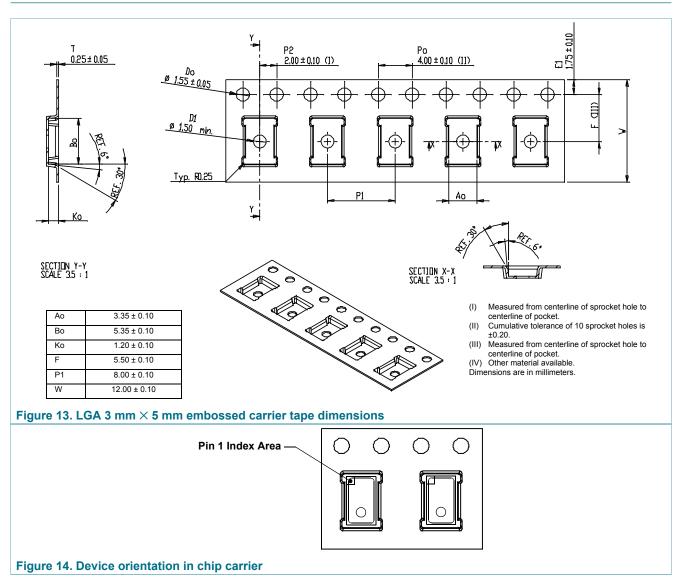

16 Tape and reel specifications

17 Related documentation

The device features and operations may be described in a variety of reference manuals, user guides, and application notes. To find the most-current versions of these documents:

- Go to the product page at <u>nxp.com/MPL3115A2</u>.
- Click on the **Documentation** tab.

I²C precision pressure sensor with altimetry

18 Revision history

Table 58. Revision h	istory							
Document ID	Release date	Data sheet status	Change notice	Supersedes				
MPL3115A2 v.5.2	20170405	Technical data	n.a.	MPL3115A2 v.5.1				
Modifications	• Revised the last sentence of paragraph three from "This value is representative as a Q18.2 fixed point format where there are 18 integer bits (including the signed bit) and two fractional bits." to "This value is representative as a Q18.2 fixed point format where there are 18 integer bits and two fractional bits." in <u>Section 13.3</u> .							
MPL3115A2 v.5.1	20160913	Technical data	n.a.	MPL3115A2 v.5.0				
MPL3115A2 v.5.0	20160816	Technical data	n.a.	MPL3115A2 v.4.0				
MPL3115A2 v.4.0	2015 September	Technical data	n.a.	MPL3115A2 v.3.0				
MPL3115A2 v.3.0	2013 December	Advanced information	n.a.	MPL3115A2 v.2.2				
MPL3115A2 v.2.2	2012 July	Advanced information	n.a.	MPL3115A2 v.2.1				
MPL3115A2 v.2.1	2012 May	Advanced information	n.a.	MPL3115A2 v.2.0				
MPL3115A2 v.2.0	2012 April	Advanced information	n.a.	MPL3115A2 v.1.0				
MPL3115A2 v.1.0	2011 December	Product preview	n.a.	MPL3115A2 v.0				
MPL3115A2 v.0	2011 June	Product preview	n.a.	n.a.				

I²C precision pressure sensor with altimetry

19 Legal information

19.1 Data sheet status

Document status ¹	Product status ²	Definition
Data sheet: Product preview	Development	This document contains certain information on a product under development. NXP reserves the right to change or discontinue this product without notice.
Data sheet: Advance information	Qualification	This document contains information on a new product. Specifications and information herein are subject to change without notice.
Data sheet: Technical data	Production	NXP Semiconductors reserves the right to change the detail specifications as may be required to permit improvements in the design of its products.

[1] Please consult the most recently issued document before initiating or completing a design.

[2] The product status of device(s) described in this document may have changed since this document was published and may differ in case of multiple devices. The latest product status information is available on the Internet at URL http://www.nxp.com.

19.2 Definitions

Draft — The document is a draft version only. The content is still under internal review and subject to formal approval, which may result in modifications or additions. NXP Semiconductors does not give any representations or warranties as to the accuracy or completeness of information included herein and shall have no liability for the consequences of use of such information.

Short data sheet — A short data sheet is an extract from a full data sheet with the same product type number(s) and title. A short data sheet is intended for quick reference only and should not be relied upon to contain detailed and full information. For detailed and full information see the relevant full data sheet, which is available on request via the local NXP Semiconductors sales office. In case of any inconsistency or conflict with the short data sheet, the full data sheet shall prevail.

Product specification — The information and data provided in a Product data sheet shall define the specification of the product as agreed between NXP Semiconductors and its customer, unless NXP Semiconductors and customer have explicitly agreed otherwise in writing. In no event however, shall an agreement be valid in which the NXP Semiconductors product is deemed to offer functions and qualities beyond those described in the Product data sheet.

19.3 Disclaimers

Information in this document is provided solely to enable system and software implementers to use NXP products. There are no express or

implied copyright licenses granted hereunder to design or fabricate any integrated circuits based on the information in this document. NXP reserves the right to make changes without further notice to any products herein.

NXP makes no warranty, representation, or guarantee regarding the suitability of its products for any particular purpose, nor does NXP assume any liability arising out of the application or use of any product or circuit, and specifically disclaims any and all liability, including without limitation consequential or incidental damages. "Typical" parameters that may be provided in NXP data sheets and/ or specifications can and do vary in different applications, and actual performance may vary over time. All operating parameters, including "typicals," must be validated for each customer application by customer's technical experts. NXP does not convey any license under its patent rights nor the rights of others. NXP sells products pursuant to standard terms and conditions of sale, which can be found at the following address: nxp.com/salestermsandconditions.

19.4 Trademarks

Notice: All referenced brands, product names, service names and trademarks are the property of their respective owners.

NXP — is a trademark of NXP B.V.

the NXP logo — is a trademark of NXP B.V.

Freescale — is a trademark of NXP B.V.

the Freescale logo — is a trademark of NXP B.V.

I²C precision pressure sensor with altimetry

Tables

Tab. 1.	Ordering information	2
Tab. 2.	Pin description	
Tab. 3.	Maximum ratings	
Tab. 4.	ESD and latchup protection characteristics	6
Tab. 5.	Mechanical characteristics	
Tab. 6.	Electrical characteristics	
Tab. 7.	Serial interface pin descriptions	
Tab. 8.	I2C Slave timing values	
Tab. 9.	Mode of operation description	
Tab. 10.	Register address map	
Tab. 11.	Register address map: Area A (F_Mode = 0,	
	FIFO disabled)	19
Tab. 12.	Register address map: Area A (F_Mode > 0,	
100.12.	FIFO in circular buffer or full stop mode)	20
Tab. 13.	Alias for DR_Status (06h) or F_Status (0Dh)	
100. 10.	registers	20
Tab. 14.	DR_STATUS - status register (address 06h)	20
140. 14.	bit allocation	20
Tab. 15.	DR STATUS - status register (address 06h)	20
Tab. 15.	bit description	21
Tab. 16.	OUT_P_MSB, OUT_P_CSB, OUT_P_LSB	21
Tab. 10.		
	- pressure and altitude data registers	22
Tab 47	(address 01h, 02h, 03h) bit allocation	22
Tab. 17.	OUT_T_MSB, OUT_T_LSB - temperature	
	data registers (address 04h, 05h) bit	~~
	allocation	23
Tab. 18.	OUT_P_DELTA_MSB,	
	OUT_P_DELTA_CSB,	
	OUT_P_DELTA_LSB - pressure and	
	altitude delta register (address 07h, 08h,	
	09h) bit allocation	23
Tab. 19.	OUT_T_DELTA_MSB,	
	OUT_T_DELTA_LSB - temperature delta	
	register (address 0Ah, 0Bh) bit allocation	24
Tab. 20.	WHO_AM_I - device ID register (address	
	0Ch) bit allocation	24
Tab. 21.	F_STATUS - FIFO status register (address	
	0Dh) bit allocation	24
Tab. 22.	F_STATUS - FIFO status register (address	
	0Dh) bit description	25
Tab. 23.	F_STATUS - FIFO status register (address	
	0Dh) bit description	25
Tab. 24.	F DATA - FIFO data register (address 0Eh)	
	bit allocation	25
Tab. 25.	Read accesses through F DATA	
Tab. 26.	F_SETUP- FIFO setup register (address	
	0Fh) bit allocation	26
Tab. 27.	F_SETUP- FIFO setup register (address	
	0Fh) bit description	27
Tab. 28.	TIME_DLY - time delay register (address	
. 45. 20.	10h) bit allocation	27
Tab. 29.	SYSMOD - system mode register (address	
100.20.	11h) bit allocation	27
Tab. 30.	SYSMOD - system mode register (address	
100.00.	11h) bit description	27

Tab. 31.	INT_SOURCE - system interrupt status	~ ~
Tab. 32.	register (address 12h) bit allocation INT SOURCE - system interrupt status	. 28
	register (address 12h) bit description	. 28
Tab. 33.	PT_DATA_CFG - sensor data register (address13h) bit allocation	
Tab. 34.	PT DATA CFG - sensor data register	. 23
140. 04.	(address13h) bit description	29
Tab. 35.	BAR_IN_MSB, BAR_IN_LSB - barometric	. 20
145.00.	pressure input register (address 14h, 15h)	
	bit allocation	30
Tab. 36.	P TGT MSB, P TGT LSB - pressure/	
	altitude target value register (address 16h,	
	17h) bit allocation	.30
Tab. 37.	T_TGT- temperature target value register	
	(address 18h) bit allocation	. 30
Tab. 38.	P WND LSB, P WND MSB - pressure/	
	altitude window value register (address 19h,	
	1Ah) bit allocation	31
Tab. 39.	T_WIN- temperature window value register	
	(address 18h) bit allocation	. 31
Tab. 40.	P_MIN_MSB, P_MIN_CSB, P_MIN_LSB	
	- minimum pressure or altitude register	
	(address 1Ch, 1Dh, 1Eh) bit allocation	.31
Tab. 41.	P_MAX_MSB, P_MAX_CSB, P_MAX_LSB	
	- maximum pressure or altitude register	
	(address 21h, 22h, 23h) bit allocation	. 32
Tab. 42.	T_MIN_MSB, T_MIN_LSB - minimum	
	temperature register (address 1Fh, 20h) bit	
	allocation	. 32
Tab. 43.	T_MAX_MSB, T_MAX_LSB - minimum	
	temperature register (address 24h, 25h) bit	
	allocation	33
Tab. 44.	CTRL_REG1 - control register 1 (address	~~
Tab 45	26h) bit allocation	.33
Tab. 45.	CTRL_REG1 - control register 1 (address	~~
Tab 40	26h) bit description	
Tab. 46. Tab. 47.	System output sample rate selection	34
Tap. 47.	CTRL_REG2 - control register 2 (address 27h) bit allocation	25
Tab. 48.	CTRL_REG2 - control register 2 (address	. 55
100. 40.	27h) bit description	35
Tab. 49.	CTRL REG3 - interrupt CTRL register	.00
100.40.	(address 28h) bit allocation	35
Tab. 50.	CTRL REG3 - interrupt CTRL register	. 00
100.00.	(address 28h) bit description	35
Tab. 51.	CTRL REG4 - interrupt enable register	.00
100.01.	(address 29h) bit allocation	.36
Tab. 52.	CTRL_REG4 - interrupt enable register	
	(address 29h) bit description	.36
Tab. 53.	CTRL_REG5 - interrupt configuration	
	register (address 2Ah) bit allocation	.37
Tab. 54.	CTRL REG5 - interrupt configuration	
	register (address 2Ah) bit description	.37
Tab. 55.	OFF_P - offset correction register (address	
	2Bh) bit allocation	39
ent is subject to lega	al disclaimers. © NXP B.V. 2017. All rights res	erved
is subject to iege	er al disclamation de la viente	u.

I²C precision pressure sensor with altimetry

Tab. 56. OFF_P - offset temperature correction register (address 2Ch) bit allocation39

Tab. 57.	OFF_H - altitude data user offset register	
	(address 2Dh) bit allocation	39
Tab. 58.	Revision history	44

Figures

Fig. 2.8-pin LGA pinout3Fig. 3.Typical application diagram3Fig. 4.I2C slave timing diagram10Fig. 5.I2C bus transmission signals11Fig. 6.Mode transition diagram11Fig. 7.Polling - no FIFO13Fig. 8.Interrupt - no FIFO14	Fig. 1.	Block diagram	2
Fig. 4.I2C slave timing diagram10Fig. 5.I2C bus transmission signals11Fig. 6.Mode transition diagram11Fig. 7.Polling - no FIFO13	Fig. 2.	8-pin LGA pinout	3
Fig. 5.I2C bus transmission signals11Fig. 6.Mode transition diagram11Fig. 7.Polling - no FIFO13	Fig. 3.	Typical application diagram	3
Fig. 5.I2C bus transmission signals11Fig. 6.Mode transition diagram11Fig. 7.Polling - no FIFO13	Fig. 4.	I2C slave timing diagram	10
Fig. 7. Polling - no FIFO 13	Fig. 5.		
	Fig. 6.	Mode transition diagram	11
Fig. 8. Interrupt - no FIFO14	Fig. 7.	Polling - no FIFO	13
	Fig. 8.		

Fig. 9.	Interrupt controller block diagram	.38
Fig. 10.	INT1/INT2 pin control logic	38
Fig. 11.	Case 98ASA00260D, LGA package	. 40
Fig. 12.	Recommended PCB landing pattern	.42
Fig. 13.	LGA 3 mm \times 5 mm embossed carrier tape	
	dimensions	. 43
Fig. 14.	Device orientation in chip carrier	.43

I²C precision pressure sensor with altimetry

Contents

1 2	General description1 Features and benefits1
3	Applications2
4	Ordering information2
5	Block diagram
6	Pinning information
6.1	Pinning3
6.2	Pin description3
7	System connections
8	Mechanical and electrical specifications4
8.1	Terminology4
8.1.1	Resolution
8.1.2	Accuracy4
8.1.2.1	Offset
8.1.2.2	Linearity4
8.1.2.3	Absolute pressure5
8.1.2.4	Span5
8.1.3	Pressure/altitude5
8.2	Absolute maximum ratings5
8.3	Mechanical characteristics6
8.4	Electrical characteristics7
9	Digital interface9
9.1	I2C characteristics9
9.2	I2C operation10
10	Modes of operation11
10.1	OFF12
10.2	STANDBY12
10.3	ACTIVE
11	Quick start setup 12
12	Quick start setup12 Functionality
12 12.1	Quick start setup12Functionality15Factory calibration15
12 12.1 12.2	Quick start setup12Functionality15Factory calibration15Barometer/altimeter function15
12 12.1 12.2 12.2.1	Quick start setup12Functionality15Factory calibration15Barometer/altimeter function15Barometric input15
12 12.1 12.2 12.2.1 12.3	Quick start setup12Functionality15Factory calibration15Barometer/altimeter function15Barometric input15Temperature function16
12 12.1 12.2 12.2.1 12.3 12.4	Quick start setup12Functionality15Factory calibration15Barometer/altimeter function15Barometric input15Temperature function16Autonomous data acquisition16
12 12.1 12.2 12.2.1 12.3 12.4 12.5	Quick start setup12Functionality15Factory calibration15Barometer/altimeter function15Barometric input15Temperature function16Autonomous data acquisition16FIFO16
12 12.1 12.2 12.2.1 12.3 12.4 12.5 12.6	Quick start setup12Functionality15Factory calibration15Barometer/altimeter function15Barometric input15Temperature function16Autonomous data acquisition16FIFO16External interrupts16
12 12.1 12.2 12.2.1 12.3 12.4 12.5 12.6 12.6.1	Quick start setup12Functionality15Factory calibration15Barometer/altimeter function15Barometric input15Temperature function16Autonomous data acquisition16FIFO16External interrupts16Reach target threshold pressure/altitude16(SRC_PTH)16
12 12.1 12.2 12.2.1 12.3 12.4 12.5 12.6 12.6.1 12.6.2	Quick start setup12Functionality15Factory calibration15Barometer/altimeter function15Barometric input15Temperature function16Autonomous data acquisition16FIFO16External interrupts16Reach target threshold pressure/altitude16Reach window target pressure/altitude16(SRC_PTH)16Reach window target pressure/altitude16
12 12.1 12.2 12.2.1 12.3 12.4 12.5 12.6 12.6.1 12.6.2 12.6.3	Quick start setup12Functionality15Factory calibration15Barometer/altimeter function15Barometric input15Temperature function16Autonomous data acquisition16FIFO16External interrupts16Reach target threshold pressure/altitude16Reach window target pressure/altitude16Reach target threshold temperature16Reach target threshold temperature16
12 12.1 12.2 12.2.1 12.3 12.4 12.5 12.6 12.6.1 12.6.2	Quick start setup12Functionality15Factory calibration15Barometer/altimeter function15Barometric input15Temperature function16Autonomous data acquisition16FIFO16External interrupts16Reach target threshold pressure/altitude16(SRC_PTH)16Reach target threshold temperature(SRC_TTH)17Reach window target temperature17
12 12.1 12.2 12.2.1 12.3 12.4 12.5 12.6 12.6.1 12.6.2 12.6.3	Quick start setup12Functionality15Factory calibration15Barometer/altimeter function15Barometric input15Temperature function16Autonomous data acquisition16FIFO16External interrupts16Reach target threshold pressure/altitude16(SRC_PTH)16Reach target threshold temperature(SRC_TTH)17Reach window target temperature17Pressure/altitude change (SRC_PCHG)17
12 12.1 12.2 12.2.1 12.3 12.4 12.5 12.6 12.6.1 12.6.2 12.6.3 12.6.4	Quick start setup12Functionality15Factory calibration15Barometer/altimeter function15Barometric input15Temperature function16Autonomous data acquisition16FIFO16External interrupts16Reach target threshold pressure/altitude16(SRC_PTH)16Reach target threshold temperature(SRC_TTH)17Reach window target temperature17Pressure/altitude change (SRC_PCHG)17Temperature change (SRC_TCHG)17
12 12.1 12.2 12.2.1 12.3 12.4 12.5 12.6 12.6.1 12.6.2 12.6.3 12.6.4 12.6.5	Quick start setup12Functionality15Factory calibration15Barometer/altimeter function15Barometric input15Temperature function16Autonomous data acquisition16FIFO16External interrupts16Reach target threshold pressure/altitude16(SRC_PTH)16Reach target threshold temperature(SRC_TTH)17Reach window target temperature17Pressure/altitude change (SRC_PCHG)17Data ready17
12 12.1 12.2 12.2.1 12.2.1 12.3 12.4 12.5 12.6 12.6.1 12.6.2 12.6.3 12.6.4 12.6.5 12.6.6	Quick start setup12Functionality15Factory calibration15Barometer/altimeter function15Barometric input15Temperature function16Autonomous data acquisition16FIFO16External interrupts16Reach target threshold pressure/altitude16(SRC_PTH)16Reach target threshold temperature(SRC_TTH)17Reach window target temperature17Pressure/altitude change (SRC_PCHG)17Data ready17FIFO event17
12 12.1 12.2 12.2.1 12.2.1 12.3 12.4 12.5 12.6 12.6.2 12.6.3 12.6.4 12.6.5 12.6.6 12.6.7 12.6.8 12.6.9	Quick start setup 12 Functionality 15 Factory calibration 15 Barometer/altimeter function 15 Barometer/altimeter function 15 Barometric input 15 Temperature function 16 Autonomous data acquisition 16 FIFO 16 External interrupts 16 Reach target threshold pressure/altitude 17 (SRC_PTH) 16 Reach target threshold temperature 17 Reach window target pressure/altitude 17 Reach window target temperature 17 Reach window target temperature 17 Pressure/altitude change (SRC_PCHG) 17 Data ready 17 FIFO event 17 Pressure/altitude and temperature delta 17
12 12.1 12.2 12.2.1 12.2.1 12.3 12.4 12.5 12.6 12.6.1 12.6.2 12.6.3 12.6.4 12.6.5 12.6.6 12.6.7 12.6.8	Quick start setup12Functionality15Factory calibration15Barometer/altimeter function15Barometric input15Temperature function16Autonomous data acquisition16FIFO16External interrupts16Reach target threshold pressure/altitude16(SRC_PTH)16Reach target threshold temperature(SRC_TTH)17Reach window target temperature17Reach window target temperature17FIFO event17Pressure/altitude change (SRC_PCHG)17Data ready17FIFO event17Pressure/altitude and temperature delta17Min/max data value storage17
12 12.1 12.2 12.2.1 12.2.1 12.3 12.4 12.5 12.6 12.6.2 12.6.3 12.6.4 12.6.5 12.6.6 12.6.7 12.6.8 12.6.9	Quick start setup12Functionality15Factory calibration15Barometer/altimeter function15Barometric input15Temperature function16Autonomous data acquisition16FIFO16External interrupts16Reach target threshold pressure/altitude16(SRC_PTH)16Reach window target pressure/altitude16Reach window target temperature17Reach window target temperature17SRC_TTH)17Pressure/altitude change (SRC_PCHG)17Data ready17FIFO event17Pressure/altitude and temperature delta17Min/max data value storage17Register descriptions18
12 12.1 12.2 12.2.1 12.3 12.4 12.5 12.6 12.6.2 12.6.3 12.6.4 12.6.5 12.6.6 12.6.7 12.6.8 12.6.9 12.6.10	Quick start setup12Functionality15Factory calibration15Barometer/altimeter function15Barometric input15Temperature function16Autonomous data acquisition16FIFO16External interrupts16Reach target threshold pressure/altitude16(SRC_PTH)16Reach target threshold temperature(SRC_TTH)17Reach window target temperature17Reach window target temperature17FIFO event17Pressure/altitude change (SRC_PCHG)17Data ready17FIFO event17Pressure/altitude and temperature delta17Min/max data value storage17

	13.2.1	Data registers with F_MODE = 00 (FIFO
		disabled)
2	13.3	OUT P MSB, OUT P CSB, OUT P LSB -
2		pressure and altitude data registers (address
2		01h, 02h, 03h)22
	13.3.1	Data registers with F MODE = 0022
3	13.4	OUT_T_MSB, OUT_T_LSB - temperature
		data registers (address 04h, 05h)23
3	13.5	OUT_P_DELTA_MSB,
fications4		OUT P DELTA CSB,
		OUT P DELTA LSB - pressure and altitude
		delta register (address 07h, 08h, 09h)23
4	13.6	OUT T DELTA MSB,
4		OUT_T_DELTA_LSB - temperature delta
4		register (address 0Ah, 0Bh)24
5	13.7	WHO_AM_I - device ID register (address
5		0Ch)
5	13.8	FIFO setup registers24
5	13.8.1	F STATUS - FIFO status register (address
6	10.0.1	0Dh)
	13.8.2	F_DATA - FIFO data register (address 0Eh)25
	13.8.3	F_SETUP- FIFO setup register (address
9	10.0.0	0Fh)
	13.9	TIME_DLY - time delay register (address
	10.5	10h)
	13.10	SYSMOD - system mode register (address
	10.10	11h)
	13.11	INT SOURCE - system interrupt status
	15.11	register (address 12h)
	13.12	PT_DATA_CFG - sensor data register
	15.12	(address13h)
	13.13	BAR_IN_MSB, BAR_IN_LSB - barometric
	15.15	pressure input register (address 14h, 15h) 29
	13.14	P_TGT_MSB, P_TGT_LSB - pressure/
16	13.14	altitude target value register (address 16h,
16		17h)
16	13.15	T TGT- temperature target value register
sure/altitude	13.15	
	12.16	(address 18h)
	13.16	' '
sure/altitude		altitude window value register (address 19h, 1Ah)
	12 17	
temperature	13.17	T_WIN- temperature window value register
	10 10	(address 18h)
temperature	13.18	P_MIN_MSB, P_MIN_CSB, P_MIN_LSB
		- minimum pressure or altitude register
_PCHG) 17	12.10	(address 1Ch, 1Dh, 1Eh)
HG) 17	13.19	P_MAX_MSB, P_MAX_CSB, P_MAX_LSB
		- maximum pressure or altitude register
	12.00	(address 21h, 22h, 23h)
ure delta 17	13.20	T_MIN_MSB, T_MIN_LSB - minimum
	12 04	temperature register (address 1Fh, 20h) 32
	13.21	T_MAX_MSB, T_MAX_LSB - maximum
ter (address	12 22	temperature register (address 24h, 25h)
	13.22	Control registers
address 06h) 20	13.22.1	CTRL_REG1 - control register 1 (address
		26h)
All information provided in this docur	ment is subject to le	gal disclaimers. © NXP B.V. 2017. All rights reserved.

MPL3115A2

I²C precision pressure sensor with altimetry

27h)	-
	2
13.22.3 CTRL_REG3 - interrupt CTRL register	
(address 28h) 38	5
13.22.4 CTRL_REG4 - interrupt enable register	
(address 29h) 36	3
13.22.5 CTRL_REG5 - interrupt configuration	
register (address 2Ah)37	
13.23 Offset correction registers	9
13.23.1 OFF_P - offset pressure correction register	
(address 2Bh)39	9
13.23.2 OFF_T - offset temperature correction	
register (address 2Ch)	9
13.23.3 OFF_H - altitude data user offset register	
(address 2Dh)	
14 Package information40	
14.1 Package dimensions40)
15 Soldering/landing pad information47	
16 Tape and reel specifications43	
17 Related documentation 43	
18 Revision history44	
19 Legal information4	5

Please be aware that important notices concerning this document and the product(s) described herein, have been included in section 'Legal information'.

© NXP B.V. 2017.

All rights reserved.

For more information, please visit: http://www.nxp.com For sales office addresses, please send an email to: salesaddresses@nxp.com

Date of release: 5 April 2017 Document identifier: MPL3115A2